



181 US Hwy 46
Mine Hill, NJ 07830
(908) 654-8068
(800) 783-0567
Fax 908-654-8069

Lead-Based Paint Evaluation Report Inspection

Performed At:

95 Glen Ave Unit:Primary
Primary
Phillipsburg Town, NJ 08865

Performed For:

Yesenia Flores
28 Anna Place
Phillipsburg, NJ 08865

Prepared By:

LEW Environmental Services, LLC.
181 US Hwy 46
Mine Hill, NJ 07803
Phone (908) 654-8068
Fax (908) 654-8069
Inspection Date: 06/17/24
Order Number: 46576

Table Of Contents

Contact Information	3
Executive Summary	4
Components with Lead Based Paint	4
Regulatory Requirements	5
Required Disclosure	5
Required Training for Workers	5
Controlling Lead-Based Paint	5
Abatement for Lead-Based Paint Free Certification	6
Component Removal	6
Paint Stripping	6
Procedures & Methodology	6
Location Conventions	6
Paint Testing	6
X-Ray Fluorescence	6
Calibration Check Readings	7

Appendices

Appendix A - Floor Plan

Appendix B - Lead-Based Paint Evaluation Report

Contact Information

Site

Street Address	95 Glen Ave Unit Primary Phillipsburg Town, NJ 08865
----------------	---

Property Owner

Name	Yesenia Flores
Street Address	28 Anna Place Phillipsburg, NJ 08865
Phone Number	908-319-3607

Lead-Based Paint Risk Assessor

Name	Yerani Heredia De Rosado
Certification Number	R001913
Instrumentation	Viken Pb200i/e
Signature	<i>Yerani Heredia</i>
Date	07/02/2024

Firm

Organization:	LEW Environmental Services, LLC.
Certification #:	NJDCA 00015
Street:	181 US Hwy 46
City, State & Zip:	Mine Hill, NJ 07803
Phone Number:	908-654-8068
Web Address:	lewenvironmental.com



181 US Hwy 46
Mine Hill, NJ 07830
(908) 654-8068
(800) 783-0567
Fax 908-654-8069

Executive Summary

For 95 Glen Ave Unit Primary
Phillipsburg Town, NJ 08865
07/02/2024

On 06/17/24, Yerani Heredia De Rosado of LEW Environmental Services, LLC (NJDCA 00015 E) performed a lead-based paint inspection at 95 Glen Ave Unit Primary . The lead-based paint inspection sampling protocol that was applied follows "Inspections in Single-Family Housing" Chapter 7 of the HUD Guidelines (2012 revision) and the protocol as referenced in USEPA 40 CFR Part 745.227(b). See Appendix B Lead Paint Inspection Report for the complete set of X-Ray Fluorescence data.

The tables below indicate the location of the lead-based paint found. Each positive reading applies to all similar components in the same room equivalent (room, hall, stairwell, building exterior, etc.) For a lead-based paint free certification, the lead must be stripped or the leaded component replaced and confirmation achieved. Enclosure and encapsulation are not acceptable methods for a lead-based paint free certification. If no lead-based paint was identified, the table will list "None" and the dwelling unit is considered lead-based paint free.

Components With Lead Based Paint

Room Equivalent	Component	Substrate	Value(mg/cm ²)
Rear Entry	Window Casing	Wood	13.7
Rear Entry	Window Sill	Wood	11.9
Rear Entry	Window Apron	Wood	12.5
Rear Entry	Shelf	Wood	11.8
Rear Entry	Room Wall	Wood	16.0
Rear Entry	Stair Treads	Wood	8.6
Rear Entry	Room Wall	Wood	11.0
Rear Entry	Room Ceiling	Wood	15.7

EPA 40 CFR 745.227(h) states lead-based paint is present on any surface that is tested and found to contain lead equal to or in excess of 1.0 milligrams per square centimeter or equal to or in excess of 0.5% by weight. Local thresholds may be lower than this Federal standard.

Regulatory Requirements

Required Disclosure

A summary of this lead-based paint evaluation report must be provided to new lessees (tenants). A complete copy of this report must be provided to purchasers and owners of this property and it must be made available to new tenants under federal law (24 CFR PART 35 AND 40 CFR PART 745) before they become obligated under a lease or sales contract. Landlords (lessors) and sellers are also required to distribute an educational pamphlet approved by the U.S. Environmental Protection Agency and include standard warning language in their leases or sales contracts to ensure that parents have the information they need to protect their children from lead-based paint hazards."

Should the recipient of this report receive federal subsidy they are responsible to comply with all requirements of 24 CFR Part 35 Requirements for the Notification, Evaluation and Reduction of Lead-Based Paint Hazards in Federally Owned Residential Property and Housing Receiving Federal Assistance; Final Rule which, are applicable to the type of program they are participating in and the dollar amount of subsidy being received. If this property or any of its tenants receives financial federal assistance, the results of the evaluation or hazard reduction activities must be provided by the designated party (client) to the owner of the referenced property and the occupants within 15 calendar days of the date when the designated party receives this report, or makes the presumption that lead-based paint hazards do exist.

Required Training for Workers

Should the lead-based paint and lead hazard reduction activities be part of a program which receives federal subsidy or a New Jersey multifamily building, all persons performing "Interim Controls" or "Standard Treatments" must be trained in accordance with 29 CFR 1926.59 and be supervised by an individual who successfully completed one of the following courses:

1. A lead-based paint abatement supervisors course accredited in accordance with 40 CFR 745.225
2. A lead-based paint abatement worker course accredited in accordance with 40 CFR 745.225
3. The lead-based paint Maintenance Training Program, "Work Smart, Work Wet, and Work Clean to Work Lead Safe", prepared by the National Environmental Training Association for EPA and HUD
4. "The Remodeler's and Renovator's Lead-Based Paint Training Program," prepared by HUD and the National Association of the Remodeling Industry
5. Another course approved by HUD for this purpose after consultation with EPA.

In accordance with Section 35.1340 all Lead-Based Paint and Lead Hazard reduction activities, which are not exempt (see regulations) require Lead Dust Wipe Clearance testing by a 1) certified lead inspector, 2) certified risk assessor or 3) a dust wipe sampling technician whose work is reviewed by a certified risk assessor.

If a renovation at the property is to occur, all work should comply with 40 CFR 745 Subpart E- Residential Property Renovation.

Controlling Lead-Based Paint

There are different options available for controlling lead-based paint. Each option has its own associated costs and benefits both short and long term. In most cases, a combination of the options can be implemented to reduce the possibility of lead contamination. LEW Environmental Services,

LLC. strongly suggests that each option is thoroughly contemplated before beginning any activity.

Components that are found to be positive for lead-based paint should be checked for deterioration. Lead-based paint in deteriorated condition is considered a paint-lead hazard. Those components should be address as soon as possible using lead safe work practices at a minimum. However, if any components are found to test positive for lead based paint, they should be considered for future component removal or paint stripping.

Abatement for Lead-Based Paint Free Certification

Component Removal

Component removal is a permanent solution to the issue of potential exposure of lead. It requires taking the old lead-based painted component out and replacing it with a new non-lead painted component. The cost associated with this option depends mostly on the cost of the replacement component. Since labor is most often the more costly aspect of controlling lead issues, many owners choose component removal over more labor intensive methods. Components often chosen for removal are wood trim, windows, most doors, and exterior railings. Plaster and drywall ceilings and walls, fire rated doors, and wood porch components should also be considered.

Paint Stripping

Paint stripping is a permanent solution to the issue of potential exposure of lead. The paint can be removed either in-place or by an off-site processing facility. In-place removal can be mechanical or chemical. In-place paint stripping has the issue of proper disposal of the hazardous waste generated.

Mechanical stripping scrapes the paint off the substrate. Most times dry scraping is prohibited, but sanding or scraping can be done in conjunction with engineering controls to reduce airborne and settled lead dust. Power tools used to remove the paint must be equipped with a HEPA filtered shroud. Wetting a surface and hand scraping is also permitted. The components most often chosen for hand scraping are window and door jambs. Power tools are better equipped to handle larger surface areas.

Chemical stripping in-place uses strong chemicals to soften the paint for easier removal from the substrate. The chemicals are either very acidic or very basic, so proper training and protection for the worker is imperative. Generally, the chemicals must remain in- place overnight, so maintaining a secure worksite separate from occupants is mandatory.

Off site facilities use much stronger chemicals to remove the lead-based paint from the component. Components often chosen for off-site paint removal are intricate metal pieces. Sometimes this method is used for intricate wood work, but the stronger chemicals soften the wood and can drive lead into the wood while removing the paint.

Procedures & Methodology

Location Conventions

When reviewing Appendix A "Floor Plan" and Appendix B "Lead-Based Paint Evaluation Report", you will notice that the letters A, B, C, and D or the numbers 1, 2, 3 and 4 are used to identify the location of specific components. The key to correct orientation is the location of the "A" or "1" wall. The "B" or "2" wall, "C" or "3" wall, and "D" or "4" wall run clockwise from the "A" or "1" wall. The Lead-Based Paint Evaluation Report lists this information under the "Wall" column. The "Location"

column uses numbering of replicated components starting with "1" at left and continuing sequentially to right respectively to describe the location of the component while facing the wall identified.

Paint Testing

X-Ray Fluorescence

X-Ray Fluorescence (XRF) paint testing is performed to detect the presence of lead on painted surfaces. The XRF instrument is state-of-the art equipment. XRF testing is usually the preferred method of testing, because it is non-destructive, quantitative and can be performed on the spot with acceptable accuracy. LEW Environmental Services, LLC. 's evaluators follow the manufacturer's suggested use and the Performance Characteristic Sheet of the XRF instrument being used. The results of the XRF testing are the basis for drawing conclusions and making recommendations in the report.

All LEW Environmental Services, LLC. 's evaluators follow 40 CFR 745 and the HUD Guidelines for testing lead using an XRF instrument. All federal, state and city regulations are followed when applicable. The evaluator will test one of each and every different type of testing combination (component) in each room being surveyed. Each XRF reading is assigned an exclusive sample reference number and a measurement that is stored in the instrument. Each sample reference number location is logged on the XRF instrument for future reference, testing location, and report generation. The above described testing format is followed unless otherwise not practical or if the evaluator's judgment decides to test in a different systematic approach.

It should be noted that detected lead levels below current levels still could create lead dust or lead-contaminated soil hazards if the paint is turned into dust by abrasion, scraping, or sanding leading to possible elevated blood lead levels. Lead poisoning is a cumulative affect. Should a child or an adult inhale or ingest sufficient quantities of low concentrations of lead paint, dust, or soil, it will accumulate in the body's systems and could eventually cumulate to an elevated blood level of concern.

Any untested building components should be considered lead-based paint until tested.

Calibration Check Readings

In addition to the manufacturer's recommended warm up and quality control procedures, LEW Environmental Services, LLC. collects quality control readings as recommended in the HUD Guidelines. Quality control for XRF instrumentation instruments involves readings to check calibration.

For each XRF instrument, one set of XRF calibration check readings are recommended at least every four hours. The first is a set of three nominal-time or source decay corrected time XRF calibration check readings to be taken before the inspection begins for the day. The second occurs either after the day's inspection work has been completed, or at least every four hours, whichever occurs first. LEW Environmental Services, LLC. 's XRF calibration check readings are taken on the Standard Reference Material (SRM) paint film nearest to 1.0 mg/cm^2 within the National Institute of Standards and Technology (NIST) SRM Used or the XRF manufacturer's factory supplied SRM film. Three readings are collected on the SRM. The average of the three readings on the SRM must be within the acceptable plus and minus tolerances for proper calibration as detailed in the Performance Characteristic Sheet (PCS). All calibration checks are taken with the SRM film positioned at least several inches away from any potential source of lead.

Three readings are taken each time calibration check readings are made. The average of the readings are compared to the known value and if the average value is within the acceptable calibration check tolerance specified in the XRF Performance Characteristic Sheet the instrument is considered in control. If the average readings are not within the calibration check tolerance the instrument is not used until the instrument is brought back into control.

Company LEW Corporation
 XRF Make Heuresis
 Model Pb200i
 Serial Num. 2819
 Lead concentration units: mg/cm²
 Total Readings: 160
 Action Level 1
 Mode Action Level
 Analytic Mode Paint

All Readings

Job Id	Reading #	Concentration	Result	Calibration	RTA Present	Date	Time	User	Analytic Mode	Site Address	Area	Unit #	Room	Structure	Member	Substrate	Wall	Location	Condition	Cause
6171114	47392	1.1		TRUE	FALSE	6/17/2024	11:15 AM	Yerani Heredia	Paint	95 Glen Ave.										
6171114	47393	1		TRUE	FALSE	6/17/2024	11:16 AM	Yerani Heredia	Paint	95 Glen Ave.										
6171114	47394	1		TRUE	FALSE	6/17/2024	11:16 AM	Yerani Heredia	Paint	95 Glen Ave.										
6171114	47395	0		TRUE	FALSE	6/17/2024	11:17 AM	Yerani Heredia	Paint	95 Glen Ave.										
6171114	47396	0		TRUE	FALSE	6/17/2024	11:17 AM	Yerani Heredia	Paint	95 Glen Ave.										
6171114	47397	0		TRUE	FALSE	6/17/2024	11:18 AM	Yerani Heredia	Paint	95 Glen Ave.										
6171114	47398	0.1	Negative	FALSE	FALSE	6/17/2024	11:18 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Door	---	Wood	A	1	Intact	
6171114	47399	-0.1	Negative	FALSE	FALSE	6/17/2024	11:19 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Door	Jamb	Wood	A	1	Intact	
6171114	47400	0.1	Negative	FALSE	FALSE	6/17/2024	11:19 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Door	Casing	Wood	A	1	Intact	
6171114	47401	0.1	Negative	FALSE	FALSE	6/17/2024	11:20 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Window	Casing	Wood	A	1	Intact	
6171114	47402	-0.1	Negative	FALSE	FALSE	6/17/2024	11:20 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Window	Sill	Wood	A	1	Intact	
6171114	47403	-0.1	Negative	FALSE	FALSE	6/17/2024	11:21 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Window	Apron	Wood	A	1	Intact	
6171114	47404	0	Negative	FALSE	FALSE	6/17/2024	11:21 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Room	Baseboard	Wood	A	1	Intact	
6171114	47405	0.1	Negative	FALSE	FALSE	6/17/2024	11:22 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Room	Wall	Plaster	A	1	Intact	
6171114	47406	0.1	Negative	FALSE	FALSE	6/17/2024	11:22 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Room	Wall	Plaster	B	1	Intact	
6171114	47407	0	Negative	FALSE	FALSE	6/17/2024	11:23 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Room	Wall	Plaster	C	1	Intact	
6171114	47408	0.1	Negative	FALSE	FALSE	6/17/2024	11:23 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Room	Wall	Plaster	D	1	Intact	
6171114	47409	0	Negative	FALSE	FALSE	6/17/2024	11:24 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Room	Ceiling	Drywall	D	1	Intact	
6171114	47410	0.2	Negative	FALSE	FALSE	6/17/2024	11:24 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Risers	Wood	B	1	Intact	
6171114	47411	0.2	Negative	FALSE	FALSE	6/17/2024	11:25 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Stringer	Wood	B	1	Intact	
6171114	47412	0	Negative	FALSE	FALSE	6/17/2024	11:25 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Newel Post	Wood	B	1	Intact	
6171114	47413	0	Negative	FALSE	FALSE	6/17/2024	11:26 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Railing	Wood	B	1	Intact	
6171114	47414	0	Negative	FALSE	FALSE	6/17/2024	11:26 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Balusters	Wood	B	1	Intact	
6171114	47415	0.1	Negative	FALSE	FALSE	6/17/2024	11:27 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Underside	Wood	B	1	Intact	
6171114	47416	-0.1	Negative	FALSE	FALSE	6/17/2024	11:27 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Door	Casing	Wood	B	1	Intact	
6171114	47417	0.2	Negative	FALSE	FALSE	6/17/2024	11:28 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Room	Wall	Plaster	A	1	Intact	
6171114	47418	0	Negative	FALSE	FALSE	6/17/2024	11:29 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Room	Wall	Plaster	B	1	Intact	
6171114	47419	0.1	Negative	FALSE	FALSE	6/17/2024	11:29 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Room	Wall	Plaster	C	1	Intact	
6171114	47420	0.1	Negative	FALSE	FALSE	6/17/2024	11:30 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Room	Wall	Plaster	D	1	Intact	
6171114	47421	0	Negative	FALSE	FALSE	6/17/2024	11:31 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Window	Casing	Wood	A	1	Intact	
6171114	47422	0.2	Negative	FALSE	FALSE	6/17/2024	11:32 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Window	Sill	Wood	A	1	Intact	
6171114	47423	-0.1	Negative	FALSE	FALSE	6/17/2024	11:32 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Window	Apron	Wood	A	1	Intact	
6171114	47424	-0.1	Negative	FALSE	FALSE	6/17/2024	11:33 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Living Room	Room	Baseboard	Wood	A	1	Intact	
6171114	47425	0	Negative	FALSE	FALSE	6/17/2024	11:34 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Room	Baseboard	Wood	A	1	Intact	
6171114	47426	0.2	Negative	FALSE	FALSE	6/17/2024	11:34 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Room	Wall	Plaster	A	1	Intact	
6171114	47427	0.1	Negative	FALSE	FALSE	6/17/2024	11:35 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Room	Wall	Plaster	B	1	Intact	
6171114	47428	0.1	Negative	FALSE	FALSE	6/17/2024	11:35 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Room	Wall	Plaster	C	1	Intact	
6171114	47429	0.1	Negative	FALSE	FALSE	6/17/2024	11:36 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Room	Wall	Plaster	D	1	Intact	
6171114	47430	0	Negative	FALSE	FALSE	6/17/2024	11:36 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Window	Casing	Wood	D	1	Intact	
6171114	47431	0	Negative	FALSE	FALSE	6/17/2024	11:37 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Window	Sill	Wood	D	1	Intact	
6171114	47432	-0.1	Negative	FALSE	FALSE	6/17/2024	11:38 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Dining Room	Window	Apron	Wood	D	1	Intact	
6171114	47433	0.1	Negative	FALSE	FALSE	6/17/2024	11:39 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Door	---	Wood	D	1	Intact	
6171114	47434	0	Negative	FALSE	FALSE	6/17/2024	11:39 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Door	Jamb	Wood	D	1	Intact	
6171114	47435	0	Negative	FALSE	FALSE	6/17/2024	11:40 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Door	Casing	Wood	D	1	Intact	
6171114	47436	0.1	Negative	FALSE	FALSE	6/17/2024	11:41 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Door	Casing	Wood	A	1	Intact	
6171114	47437	0.3	Negative	FALSE	FALSE	6/17/2024	11:41 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Room	Wall	Plaster	A	1	Intact	

Job Id	Reading #	Concentration	Result	Calibration	RTA Present	Date	Time	User	Analytic Mode	Site Address	Area	Unit #	Room	Structure	Member	Substrate	Wall	Location	Condition	Cause
6171114	47438	0.1	Negative	FALSE	FALSE	6/17/2024	11:42 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Room	Wall	Plaster	B	1	Intact	
6171114	47439	0.1	Negative	FALSE	FALSE	6/17/2024	11:42 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Room	Wall	Plaster	C	1	Intact	
6171114	47440	0.2	Negative	FALSE	FALSE	6/17/2024	11:43 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Room	Wall	Plaster	D	1	Intact	
6171114	47441	-0.1	Negative	FALSE	FALSE	6/17/2024	11:43 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Room	Baseboard	Wood	D	1	Intact	
6171114	47442	0	Negative	FALSE	FALSE	6/17/2024	11:44 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Window	Casing	Wood	B	1	Intact	
6171114	47443	-0.1	Negative	FALSE	FALSE	6/17/2024	11:45 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Kitchen	Window	Sill	Wood	B	1	Intact	
6171114	47444	0.1	Negative	FALSE	FALSE	6/17/2024	11:46 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Door	---	Metal	C	1	Intact	
6171114	47445	0.1	Negative	FALSE	FALSE	6/17/2024	11:46 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Door	Jamb	Wood	C	1	Intact	
6171114	47446	0.2	Negative	FALSE	FALSE	6/17/2024	11:47 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Door	Casing	Wood	C	1	Intact	
6171114	47447	13.7	Positive	FALSE	FALSE	6/17/2024	11:47 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Window	Casing	Wood	C	1	Intact	
6171114	47448	11.9	Positive	FALSE	FALSE	6/17/2024	11:48 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Window	Sill	Wood	C	1	Intact	
6171114	47449	12.5	Positive	FALSE	FALSE	6/17/2024	11:49 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Window	Apron	Wood	C	1	Intact	
6171114	47450	11.8	Positive	FALSE	FALSE	6/17/2024	11:50 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Shelf	---	Wood	C	1	Intact	
6171114	47451	16	Positive	FALSE	FALSE	6/17/2024	11:50 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Wall	Wood	C	1	Intact	
6171114	47452	0.1	Negative	FALSE	FALSE	6/17/2024	11:51 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Wall	Wood	A	1	Intact	
6171114	47453	8.6	Positive	FALSE	FALSE	6/17/2024	11:52 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Stair	Treads	Wood	D	1	Intact	
6171114	47454	11	Positive	FALSE	FALSE	6/17/2024	11:56 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Wall	Wood	D	1	Intact	
6171114	47455	0.2	Negative	FALSE	FALSE	6/17/2024	11:56 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Wall	Concrete	D	1	Intact	
6171114	47456	0.1	Negative	FALSE	FALSE	6/17/2024	11:57 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Door	---	Wood	C	1	Intact	
6171114	47457	-0.1	Negative	FALSE	FALSE	6/17/2024	11:58 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Door	Casing	Wood	C	1	Intact	
6171114	47458	0.1	Negative	FALSE	FALSE	6/17/2024	11:58 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Room	Wall	Plaster	A	1	Intact	
6171114	47459	0	Negative	FALSE	FALSE	6/17/2024	11:59 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Room	Wall	Plaster	B	1	Intact	
6171114	47460	0.1	Negative	FALSE	FALSE	6/17/2024	11:59 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Room	Wall	Plaster	C	1	Intact	
6171114	47461	0.1	Negative	FALSE	FALSE	6/17/2024	12:00 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Room	Wall	Plaster	D	1	Intact	
6171114	47462	0	Negative	FALSE	FALSE	6/17/2024	12:02 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	1/2 Bathroom	Room	Ceiling	Drywall	D	1	Intact	
6171114	47463	0.1	Negative	FALSE	FALSE	6/17/2024	12:03 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Foyer	Stair	Wall	Plaster	C	1	Intact	
6171114	47464	0.2	Negative	FALSE	FALSE	6/17/2024	12:04 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Room	Wall	Plaster	A	1	Intact	
6171114	47465	0	Negative	FALSE	FALSE	6/17/2024	12:04 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Room	Wall	Plaster	B	1	Intact	
6171114	47466	0.3	Negative	FALSE	FALSE	6/17/2024	12:05 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Room	Wall	Plaster	C	1	Intact	
6171114	47467	0.2	Negative	FALSE	FALSE	6/17/2024	12:05 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Room	Wall	Plaster	D	1	Intact	
6171114	47468	0.1	Negative	FALSE	FALSE	6/17/2024	12:06 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Room	Baseboard	Wood	D	1	Intact	
6171114	47469	0.2	Negative	FALSE	FALSE	6/17/2024	12:06 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Door	---	Wood	D	1	Intact	
6171114	47470	-0.1	Negative	FALSE	FALSE	6/17/2024	12:07 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Door	Jamb	Wood	D	1	Intact	
6171114	47471	-0.1	Negative	FALSE	FALSE	6/17/2024	12:07 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Door	Casing	Wood	D	1	Intact	
6171114	47472	-0.1	Negative	FALSE	FALSE	6/17/2024	12:08 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Door	---	Wood	D	1	Intact	
6171114	47473	0.1	Negative	FALSE	FALSE	6/17/2024	12:08 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Door	Jamb	Wood	D	1	Intact	
6171114	47474	0	Negative	FALSE	FALSE	6/17/2024	12:09 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Door	Casing	Wood	D	1	Intact	
6171114	47475	0.2	Negative	FALSE	FALSE	6/17/2024	12:09 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Room	Wall	Plaster	A	1	Intact	
6171114	47476	0.1	Negative	FALSE	FALSE	6/17/2024	12:10 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Room	Wall	Plaster	B	1	Intact	
6171114	47477	0.2	Negative	FALSE	FALSE	6/17/2024	12:10 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Room	Wall	Plaster	C	1	Intact	
6171114	47478	-0.1	Negative	FALSE	FALSE	6/17/2024	12:11 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Room	Wall	Plaster	D	1	Intact	
6171114	47479	0	Negative	FALSE	FALSE	6/17/2024	12:11 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Room	Baseboard	Wood	D	1	Intact	
6171114	47480	0	Negative	FALSE	FALSE	6/17/2024	12:12 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Room	Ceiling	Drywall	D	1	Intact	
6171114	47481	0	Negative	FALSE	FALSE	6/17/2024	12:13 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Window	Casing	Drywall	B	1	Intact	
6171114	47482	-0.1	Negative	FALSE	FALSE	6/17/2024	12:13 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Window	Sill	Wood	B	1	Intact	
6171114	47483	0	Negative	FALSE	FALSE	6/17/2024	12:14 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bathroom	Window	Apron	Wood	B	1	Intact	
6171114	47484	0.1	Negative	FALSE	FALSE	6/17/2024	12:15 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Door	---	Wood	B	1	Intact	
6171114	47485	0	Negative	FALSE	FALSE	6/17/2024	12:15 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Door	Jamb	Wood	B	1	Intact	
6171114	47486	0	Negative	FALSE	FALSE	6/17/2024	12:16 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Door	Casing	Wood	B	1	Intact	
6171114	47487	0	Negative	FALSE	FALSE	6/17/2024	12:16 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Room	Wall	Plaster	B	1	Intact	
6171114	47488	0.2	Negative	FALSE	FALSE	6/17/2024	12:17 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Room	Wall	Plaster	B	1	Intact	
6171114	47489	0.1	Negative	FALSE	FALSE	6/17/2024	12:17 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Room	Wall	Plaster	C	1	Intact	
6171114	47490	0	Negative	FALSE	FALSE	6/17/2024	12:18 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Room	Wall	Plaster	D	1	Intact	
6171114	47491	0	Negative	FALSE	FALSE	6/17/2024	12:18 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Room	Baseboard	Wood	D	1	Intact	
6171114	47492	0	Negative	FALSE	FALSE	6/17/2024	12:19 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Window	Casing	Wood	A	1	Intact	
6171114	47493	-0.1	Negative	FALSE	FALSE	6/17/2024	12:20 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Window	Sill	Wood	A	1	Intact	
6171114	47494	0	Negative	FALSE	FALSE	6/17/2024	12:20 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Closet	Door	Wood	D	1	Intact	
6171114	47495	0.1	Negative	FALSE	FALSE	6/17/2024	12:21 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Closet	Door Jamb	Wood	D	1	Intact	

Job Id	Reading #	Concentration	Result	Calibration	RTA Present	Date	Time	User	Analytic Mode	Site Address	Area	Unit #	Room	Structure	Member	Substrate	Wall	Location	Condition	Cause
6171114	47496	0	Negative	FALSE	FALSE	6/17/2024	12:22 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Closet	Door Casing	Wood	D	1	Intact	
6171114	47497	-0.2	Negative	FALSE	FALSE	6/17/2024	12:22 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Closet	Shelf	Wood	D	1	Intact	
6171114	47498	-0.1	Negative	FALSE	FALSE	6/17/2024	12:23 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Closet	Shelf Support	Wood	D	1	Intact	
6171114	47499	0.6	Negative	FALSE	FALSE	6/17/2024	12:23 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Closet	Wall	Plaster	D	1	Intact	
6171114	47500	0.1	Negative	FALSE	FALSE	6/17/2024	12:25 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Room	Ceiling	Drywall	D	1	Intact	
6171114	47501	0.1	Negative	FALSE	FALSE	6/17/2024	12:26 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Door	---	Wood	C	1	Intact	
6171114	47502	0	Negative	FALSE	FALSE	6/17/2024	12:26 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Door	Jamb	Wood	C	1	Intact	
6171114	47503	-0.1	Negative	FALSE	FALSE	6/17/2024	12:27 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 3	Door	Casing	Wood	C	1	Intact	
6171114	47504	0.2	Negative	FALSE	FALSE	6/17/2024	12:28 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Door	---	Wood	C	1	Intact	
6171114	47505	0	Negative	FALSE	FALSE	6/17/2024	12:28 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Door	Jamb	Wood	C	1	Intact	
6171114	47506	0.1	Negative	FALSE	FALSE	6/17/2024	12:29 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Door	Casing	Wood	C	1	Intact	
6171114	47507	-0.4	Negative	FALSE	FALSE	6/17/2024	12:29 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Room	Wall	Plaster	A	1	Intact	
6171114	47508	0	Negative	FALSE	FALSE	6/17/2024	12:30 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Room	Wall	Plaster	B	1	Intact	
6171114	47509	0.2	Negative	FALSE	FALSE	6/17/2024	12:30 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Room	Wall	Plaster	C	1	Intact	
6171114	47510	0	Negative	FALSE	FALSE	6/17/2024	12:31 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Room	Wall	Plaster	D	1	Intact	
6171114	47511	-0.2	Negative	FALSE	FALSE	6/17/2024	12:32 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Room	Baseboard	Wood	D	1	Intact	
6171114	47512	-0.1	Negative	FALSE	FALSE	6/17/2024	12:32 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Door	Wood	D	1	Intact	
6171114	47513	0.1	Negative	FALSE	FALSE	6/17/2024	12:33 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Door Jamb	Wood	D	1	Intact	
6171114	47514	0.1	Negative	FALSE	FALSE	6/17/2024	12:33 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Door Casing	Wood	D	1	Intact	
6171114	47515	0	Negative	FALSE	FALSE	6/17/2024	12:34 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Wall	Plaster	D	1	Intact	
6171114	47516	0.1	Negative	FALSE	FALSE	6/17/2024	12:35 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Baseboard	Wood	D	1	Intact	
6171114	47517	0.2	Negative	FALSE	FALSE	6/17/2024	12:36 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Wall	Plaster	D	1	Intact	
6171114	47518	-0.3	Negative	FALSE	FALSE	6/17/2024	12:37 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Closet	Shelf Support	Wood	D	1	Intact	
6171114	47519	0.1	Negative	FALSE	FALSE	6/17/2024	12:38 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Window	Casing	Wood	C	1	Intact	
6171114	47520	0.1	Negative	FALSE	FALSE	6/17/2024	12:38 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Window	Sill	Wood	C	1	Intact	
6171114	47521	-0.1	Negative	FALSE	FALSE	6/17/2024	12:39 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Window	Apron	Wood	C	1	Intact	
6171114	47522	0.2	Negative	FALSE	FALSE	6/17/2024	12:40 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Door	---	Wood	C	1	Intact	
6171114	47523	0.1	Negative	FALSE	FALSE	6/17/2024	12:40 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Door	Jamb	Wood	C	1	Intact	
6171114	47524	-0.1	Negative	FALSE	FALSE	6/17/2024	12:41 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Door	Casing	Wood	C	1	Intact	
6171114	47525	0.1	Negative	FALSE	FALSE	6/17/2024	12:41 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Window	Casing	Wood	A	1	Intact	
6171114	47526	0.1	Negative	FALSE	FALSE	6/17/2024	12:42 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Window	Sill	Wood	A	1	Intact	
6171114	47527	0.1	Negative	FALSE	FALSE	6/17/2024	12:42 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Window	Apron	Wood	A	1	Intact	
6171114	47528	0.1	Negative	FALSE	FALSE	6/17/2024	12:43 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Room	Wall	Plaster	A	1	Intact	
6171114	47529	0.1	Negative	FALSE	FALSE	6/17/2024	12:43 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Room	Wall	Plaster	B	1	Intact	
6171114	47530	-0.2	Negative	FALSE	FALSE	6/17/2024	12:44 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Room	Wall	Plaster	C	1	Intact	
6171114	47531	0.1	Negative	FALSE	FALSE	6/17/2024	12:44 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Room	Wall	Plaster	D	1	Intact	
6171114	47532	0.1	Negative	FALSE	FALSE	6/17/2024	12:45 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Room	Baseboard	Wood	D	1	Intact	
6171114	47533	0.1	Negative	FALSE	FALSE	6/17/2024	12:46 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Door	---	Wood	B	1	Intact	
6171114	47534	0.1	Negative	FALSE	FALSE	6/17/2024	12:46 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Door	Jamb	Wood	B	1	Intact	
6171114	47535	0	Negative	FALSE	FALSE	6/17/2024	12:46 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Door	Casing	Wood	B	1	Intact	
6171114	47536	0.2	Negative	FALSE	FALSE	6/17/2024	12:47 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Room	Wall	Plaster	A	1	Intact	
6171114	47537	0	Negative	FALSE	FALSE	6/17/2024	12:48 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Room	Wall	Plaster	B	1	Intact	
6171114	47538	0.1	Negative	FALSE	FALSE	6/17/2024	12:48 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Room	Wall	Plaster	C	1	Intact	
6171114	47539	0.1	Negative	FALSE	FALSE	6/17/2024	12:49 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Room	Wall	Plaster	D	1	Intact	
6171114	47540	-0.1	Negative	FALSE	FALSE	6/17/2024	12:50 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Room	Baseboard	Wood	D	1	Intact	
6171114	47541	0.1	Negative	FALSE	FALSE	6/17/2024	12:50 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Window	Casing	Wood	C	1	Intact	
6171114	47542	0.1	Negative	FALSE	FALSE	6/17/2024	12:51 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Window	Sill	Wood	C	1	Intact	
6171114	47543	0	Negative	FALSE	FALSE	6/17/2024	12:51 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Door	Wood	B	1	Intact	
6171114	47544	-0.1	Negative	FALSE	FALSE	6/17/2024	12:52 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Door Jamb	Wood	B	1	Intact	
6171114	47545	-0.1	Negative	FALSE	FALSE	6/17/2024	12:52 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Door Casing	Wood	B	1	Intact	
6171114	47546	0	Negative	FALSE	FALSE	6/17/2024	12:53 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Shelf	Wood	B	1	Intact	
6171114	47547	0.2	Negative	FALSE	FALSE	6/17/2024	12:53 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Shelf Support	Wood	B	1	Intact	
6171114	47548	0.1	Negative	FALSE	FALSE	6/17/2024	12:54 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Shelf	Wood	B	1	Intact	
6171114	47549	-0.5	Negative	FALSE	FALSE	6/17/2024	12:55 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Closet	Wall	Plaster	B	1	Intact	
6171114	47550	0.1	Negative	FALSE	FALSE	6/17/2024	12:56 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 2	Room	Ceiling	Wood	B	1	Intact	
6171114	47551	-0.1	Negative	FALSE	FALSE	6/17/2024	12:57 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	2nd Floor Hallway	Room	Ceiling	Wood	B	1	Intact	
6171114	47552	0.1	Negative	FALSE	FALSE	6/17/2024	12:58 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 1	Room	Ceiling	Wood	B	1	Intact	
6171114	47553	0.1	Negative	FALSE	FALSE	6/17/2024	1:00 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Bedroom 4	Room	Ceiling	Wood	B	1	Intact	

Company LEW Corporation
 XRF Make Heuresis
 Model Pb200i
 Serial Num. 2819

Lead concentration units: mg/cm²

Total Readings: 160 Total Positives 8

Action Level 1

Mode Action Level

Analytic Mode Paint

Actionables

Job Id	Reading #	Concentration	Result	Calibration	RTA Present	Date	Time	User	Analytic Mode	Site Address	Area	Unit #	Room	Structure	Member	Substrate	Wall	Location	Condition	Cause
6171114	47447	13.7	Positive	FALSE	FALSE	6/17/2024	11:47 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Window	Casing	Wood	C	1	Intact	
6171114	47448	11.9	Positive	FALSE	FALSE	6/17/2024	11:48 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Window	Sill	Wood	C	1	Intact	
6171114	47449	12.5	Positive	FALSE	FALSE	6/17/2024	11:49 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Window	Apron	Wood	C	1	Intact	
6171114	47450	11.8	Positive	FALSE	FALSE	6/17/2024	11:50 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Shelf	---	Wood	C	1	Intact	
6171114	47451	16	Positive	FALSE	FALSE	6/17/2024	11:50 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Wall	Wood	C	1	Intact	
6171114	47453	8.6	Positive	FALSE	FALSE	6/17/2024	11:52 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Stair	Treads	Wood	D	1	Intact	
6171114	47454	11	Positive	FALSE	FALSE	6/17/2024	11:56 AM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Wall	Wood	D	1	Intact	
6171114	47557	15.7	Positive	FALSE	FALSE	6/17/2024	1:05 PM	Yerani Heredia	Paint	95 Glen Ave.	Unit	1	Rear Entry	Room	Ceiling	Wood	B	1	Intact	

Company	LEW Corporation
XRF Make	Heuresis
Model	Pb200i
Serial Num.	2819

Lead concentration units: mg/cm²

Total Readings: 160 Total Hazards 0

Action Level 1

Mode Action Level

Analytic Mode Paint

Hazards

Floor Plan(s)



181 Route 46
Mine Hill, NJ 07803
(908)654-8068
(800)783-0567
Fax (908)654-8069
www.lewcorp.com

Site: 95 Glen Ave. Phillipsburg, NJ

