



181 US Hwy 46
Mine Hill, NJ 07830
(908) 654-8068
(800) 783-0567
Fax 908-654-8069

Lead Dust Wipe Report

For 17 Meade Street Unit:two City of Orange Township, NJ 07050
06/09/2024

On 05/30/2024, LEW Environmental Services, LLC (NJDC A 00015 E) performed a dust wipe sampling for the presence of lead at 17 Meade Street Unit:two, (the "property") in compliance with NJAC 5:28A. We conducted our inspection in accordance with all federal, state, and municipal regulations. The regulations and inspection standards require that we plan and perform the inspection to obtain a reasonable assurance about whether or not the property is at risk from lead dust.

The maintenance and the environmental conditions of the property are the responsibility of the property's management, principals, or owners. If the property, program, or any of its tenants receive financial federal assistance, the results of this evaluation must be provided by the designated party (client) to the owner of the referenced property and the occupants within 15 calendar days of the date when the designated party receives this report or makes the presumption that lead-based paint hazards exist, per the Department of Housing and Urban Development 24 CFR Part 35.125.

The following surfaces are considered actionable for the lead dust.

Room	Component
Bedroom 1	Window Sills

Identified dust hazards shall be remediated by lead dust cleaning. Cleaning shall be performed by EPA RRP certified firms using an EPA certified RRP Renovator. You can find certified EPA RRP contractors at <https://cdxappstest.epacdx.net/ocspp-oppt-leadhub/firm-location-search>. Select RRP Contractor, then NJ, then enter your zip code to search for contractors. After completion of interim control work, a lead-based paint post-remediation with dust wipes will be required.

Lead Dust Hazard Standards

Floors (Bare and Carpeted)..... < 10 ug/ft²
Window Sill..... < 100 ug/ft²

Respectfully Submitted,

Danny Feliciano
NJDOH Risk Assessor, ID#033001
Encl: Laboratory Results, Floor Plan;



7469 Whitepine Rd
 North Chesterfield, VA 23237
 Telephone: 800.347.4010

Lead Dust Wipe Analysis Report

Report Number: 24-06-00271

Client: LEW Corp
 181 US Hwy 46
 Mine Hill, NJ 07803

Received Date: 06/03/2024
Analyzed Date: 06/06/2024
Reported Date: 06/06/2024

Project/Test Address: 38924; Thomas Quinn; 17 Meade St Unit 2; Orange, NJ
Collection Date: 05/30/2024

Client Number:
 201327

Laboratory Results

Fax Number:
 Ext 18 Melissa

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft ²)	Concentration (ug/ft ²)	Narrative ID
24-06-00271-001	17-2-1	LR CC	FL	<5.00	1.00	<5.00	
24-06-00271-002	17-2-2	BR BC	FL	<5.00	1.00	<5.00	
24-06-00271-003	17-2-3	BR 2 CC	FL	<5.00	1.00	<5.00	
24-06-00271-004	17-2-4	BR 3 CC	FL	<5.00	1.00	<5.00	
24-06-00271-005	17-2-5	SUNROOM BC	FL	<5.00	1.00	<5.00	
24-06-00271-006	17-2-6	LR A1	SL	<5.00	0.503	<9.95	
24-06-00271-007	17-2-7	BR B	SL	94.0	0.410	229	
24-06-00271-008	17-2-8	BR 2 C	SL	21.6	0.750	28.8	
24-06-00271-009	17-2-9	BR 3 A	SL	<5.00	0.750	<6.67	

Environmental Hazards Services, L.L.C

Client Number: 201327

Report Number: 24-06-00271

Project/Test Address: 38924; Thomas Quinn; 17 Meade St Unit 2; Orange, NJ

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft ²)	Concentration (ug/ft ²)	Narrative ID
-------------------	----------------------	---------------------	---------	---------------	------------------------------	-------------------------------------	--------------

Method: ASTM E-1979-17/EPA SW846 7000B

Accreditation #:

Reviewed By Authorized Signatory: Candace Mason
Candace Mason
QA Chemist

The Reporting Limit (RL) is 5.00 ug Total Pb. Dust wipe area and results are calculated based on area measurements determined by the client. All internal quality control requirements associated with this batch were met, unless otherwise noted.

The condition of the samples analyzed was acceptable upon receipt per laboratory protocol unless otherwise noted on this report. Results represent the analysis of samples submitted by the client. Sample location, description, area, etc., was provided by the client. Results reported above in ug/ft² are calculated based on area supplied by the client. If the report does not contain the result for a field blank, it is due to the fact that the client did not include a field blank with their samples. These sample results do not reflect blank correction. This report shall not be reproduced except in full, without the written consent of Environmental Hazards Services, L.L.C.

ELLAP Accreditation through AIHA LAP, LLC (100420), NY ELAP #11714.

Legend	ug = microgram mL = milliliter	ug/ft ² = micrograms per square foot ft ² = square foot	Pb = lead
--------	-----------------------------------	--	-----------



ENVIRONMENTAL SERVICES

A Mainline Company


LEW Environmental Services P: (800) 783-0567

F: (908) 654-8069

Lead

Chain-of-Custody

24-06-00271

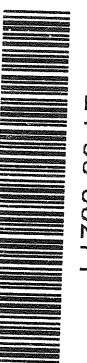

Due Date:

06/06/2024

(Thursday)

AE

* All wipes.

10+

Project Name: Thomas Quinn
 Address: 17 Meade St Unit 2
 City, State: Gauche NJ
 Project Number: 38924

Sample Type
 Dust wipe
 Paint chip
 Soil
 TCLP

Turn Around Time (TAT)
 Same Day
 1 Day
 1 Week
 3 Day
 Weekend
 2 Weeks


Sampler Information
 Name: Danny Feliciano
 Signature: Danny Feliciano

Sample #	Date Collected	Sample Location (Ex: Fl, Kitchen, AC)	Area (inches)	Paint Chip Analysis		
				mg/cm ²	PPM	% wt
17-2-1	5/30/24	LR F, ICC	12" X 12"			
2	↓	BR F, B, C	12" X 12"			
3		BR A, F, ICC	12" X 12"			
4		BR 3 F, ICC	12" X 12"			
5		Sun-room F, B, C	12" X 12"			
6		LR WS, A1	29" X 22"			
7		BR WS, B	29 1/2" X 22"			
8		BR 2 WS, E	22" X 4"			
9		BR 3 WS, A	22" X 4"			

(BCC 6/3)

Relinquished by: Danny Feliciano Signature: Danny Feliciano Date/Time: 5/30/24 5:20pm
 Received by: ECHRISTINA Signature: ECHRISTINA Date/Time: 6/3/24 3:33pm

Floor Plan(s)

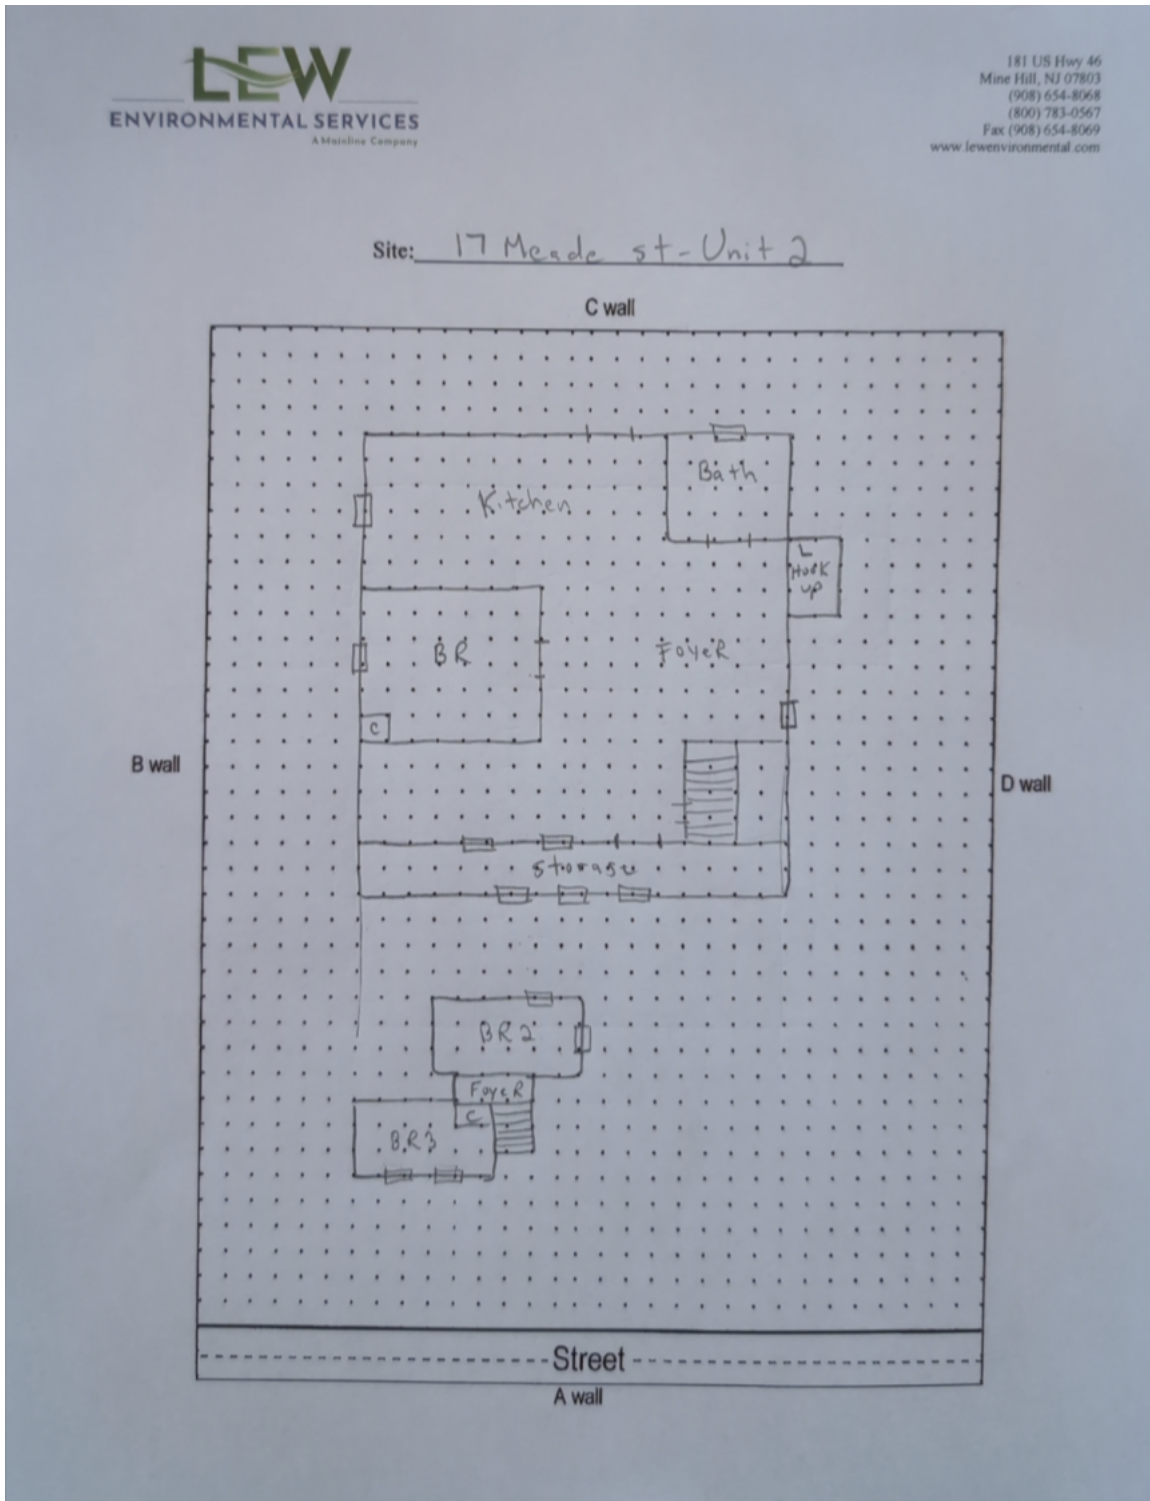

Floor 1

Lew Environmental Services - 17 Meade Street Unit:two -Visual Inspection
Prepared By: LEW Environmental Services, LLC
06/09/2024