



181 US Hwy 46
Mine Hill, NJ 07830
(908) 654-8068
(800) 783-0567
Fax 908-654-8069

Lead Dust Wipe Report

For 207 Lewis Street Unit:Primary Phillipsburg Town, NJ 08865
07/02/2024

On 06/24/2024, LEW Environmental Services, LLC (NJDC 00015 E) performed a dust wipe sampling for the presence of lead at 207 Lewis Street Unit:Primary, (the "property") in compliance with NJAC 5:28A. We conducted our inspection in accordance with all federal, state, and municipal regulations. The regulations and inspection standards require that we plan and perform the inspection to obtain a reasonable assurance about whether or not the property is at risk from lead dust.

The maintenance and the environmental conditions of the property are the responsibility of the property's management, principals, or owners. If the property, program, or any of its tenants receive financial federal assistance, the results of this evaluation must be provided by the designated party (client) to the owner of the referenced property and the occupants within 15 calendar days of the date when the designated party receives this report or makes the presumption that lead-based paint hazards exist, per the Department of Housing and Urban Development 24 CFR Part 35.125.

All dust wipes tested are not considered actionable for lead dust. The property may still contain lead painted components and lead dust re-accumulation is possible.

Respectfully Submitted,

A handwritten signature in black ink that reads 'Yerani Heredia'.

Yerani Heredia De Rosado
NJDOH Risk Assessor, NJDOH ID#R001913
Encl: Laboratory Results, Floor Plan, Lead-safe Certificate



7469 Whitepine Rd
 North Chesterfield, VA 23237
 Telephone: 800.347.4010

Lead Dust Wipe Analysis Report

Report Number: 24-06-04342

Client: LEW Corp
 181 US Hwy 46
 Mine Hill, NJ 07803

Received Date: 06/27/2024

Analyzed Date: 07/01/2024

Reported Date: 07/01/2024

Project/Test Address: 32193; Dust Wipe Sampling; 207 Lewis St; Phillipsburg, NJ

Collection Date: 06/24/2024

Client Number:
 201327

Laboratory Results

Fax Number:
 Ext 18 Melissa

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft ²)	Concentration (ug/ft ²)	Narrative ID
24-06-04342-001	1	SUNROOM AC	FL	<5.00	1.00	<5.00	
24-06-04342-002	2	2ND FLOOR HALLWAY BC	FL	<5.00	1.00	<5.00	
24-06-04342-003	3	BEDROOM 1 AC	FL	<5.00	1.00	<5.00	
24-06-04342-004	4	LIVING ROOM AC	FL	<5.00	1.00	<5.00	
24-06-04342-005	5	BEDROOM 2 AC	FL	<5.00	1.00	<5.00	
24-06-04342-006	6	DINING ROOM BC	FL	<5.00	1.00	<5.00	
24-06-04342-007	7	LIVING ROOM AC	SL	<5.00	0.990	<5.06	
24-06-04342-008	8	DINING ROOM BC	SL	<5.00	1.08	<4.63	
24-06-04342-009	9	BEDROOM 2 BC	SL	<5.00	0.856	<5.85	
24-06-04342-010	10	BEDROOM 1 BC	SL	<5.00	0.957	<5.23	

Environmental Hazards Services, L.L.C

Client Number: 201327
Project/Test Address: 32193; Dust Wipe Sampling; 207 Lewis St;
Phillipsburg, NJ

Report Number: 24-06-04342

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft ²)	Concentration (ug/ft ²)	Narrative ID
-------------------	----------------------	---------------------	---------	---------------	------------------------------	-------------------------------------	--------------

Method: ASTM E-1979-17/EPA SW846 7000B

Accreditation #:

Reviewed By Authorized Signatory:



Amanda Lowery

The Reporting Limit (RL) is 5.00 ug Total Pb. Dust wipe area and results are calculated based on area measurements determined by the client. All internal quality control requirements associated with this batch were met, unless otherwise noted.

The condition of the samples analyzed was acceptable upon receipt per laboratory protocol unless otherwise noted on this report. Results represent the analysis of samples submitted by the client. Sample location, description, area, etc., was provided by the client. Results reported above in ug/ft² are calculated based on area supplied by the client. If the report does not contain the result for a field blank, it is due to the fact that the client did not include a field blank with their samples. These sample results do not reflect blank correction. This report shall not be reproduced except in full, without the written consent of Environmental Hazards Services, L.L.C.

ELLAP Accreditation through AIHA LAP, LLC (100420), NY ELAP #11714.

Legend

ug = microgram
mL = milliliter

ug/ft² = micrograms per square foot
ft² = square foot

Pb = lead



ENVIRONMENTAL SERVICES

LEW Environmental Services
A Mainline Company
P: (800) 783-0567
F: (908) 654-8069

Lead

Chain-of-Custody



24-06-04342

Due Date:
07/02/2024
(Tuesday)
AE

* All wipes

Sampler Information

Project Name: Dust wipe sampling
Address: 207 Lewis St.
City, State: Phillipsburg NJ
Project Number: Order # 32193

Sample Type
 Dust wipe
 Paint chip
 Soil
 TCLP

Turn Around Time (TAT)
 Same Day
 1 Day
 1 Week
 3 Day
 Weekend
 2 Weeks

Name: _____
Signature: _____

Sample #	Date Collected	Sample Location (Ex: Fl, Kitchen, AC)	Area (inches)	Paint Chip Analysis		
				mg/cm ²	PPM	% wt
1	06-24-24	Floor Sw Room AC	12 x 12			
2		Floor 2nd Flr Hallway BC	12 x 12			
3		Floor Bedroom 1 AC	12 x 12			
4		Floor living Room AC	12 x 12			
5		Floor Bedroom 2 AC	12 x 12			
6		Floor Dining Room BC	12 x 12			
7		w-sill living Room, AL	30 x 4 3/4			
8		w-sill Dining Room BC	31 x 5			
9		w-sill Bedroom 2 BC	29 x 4 1/4			
10		w-sill Bedroom 1 BC	29 x 4 3/4			
			X			
			X			

Relinquished by: Yvanni Hladia Signature: Yvanni Hladia Date/Time: 06-24-24 9-10am

Received by: Jeffrey Hladia Signature: Jeffrey Hladia Date/Time: 06/27/24 12pm


10
10

Floor Plan(s)




181 Route 46
Mine Hill, NJ 07803
(908)654-8068
(800)783-0567
Fax (908)654-8069
www.lewcorp.com

Site: 207 Lewis St. Phillipsburg, NJ
32193

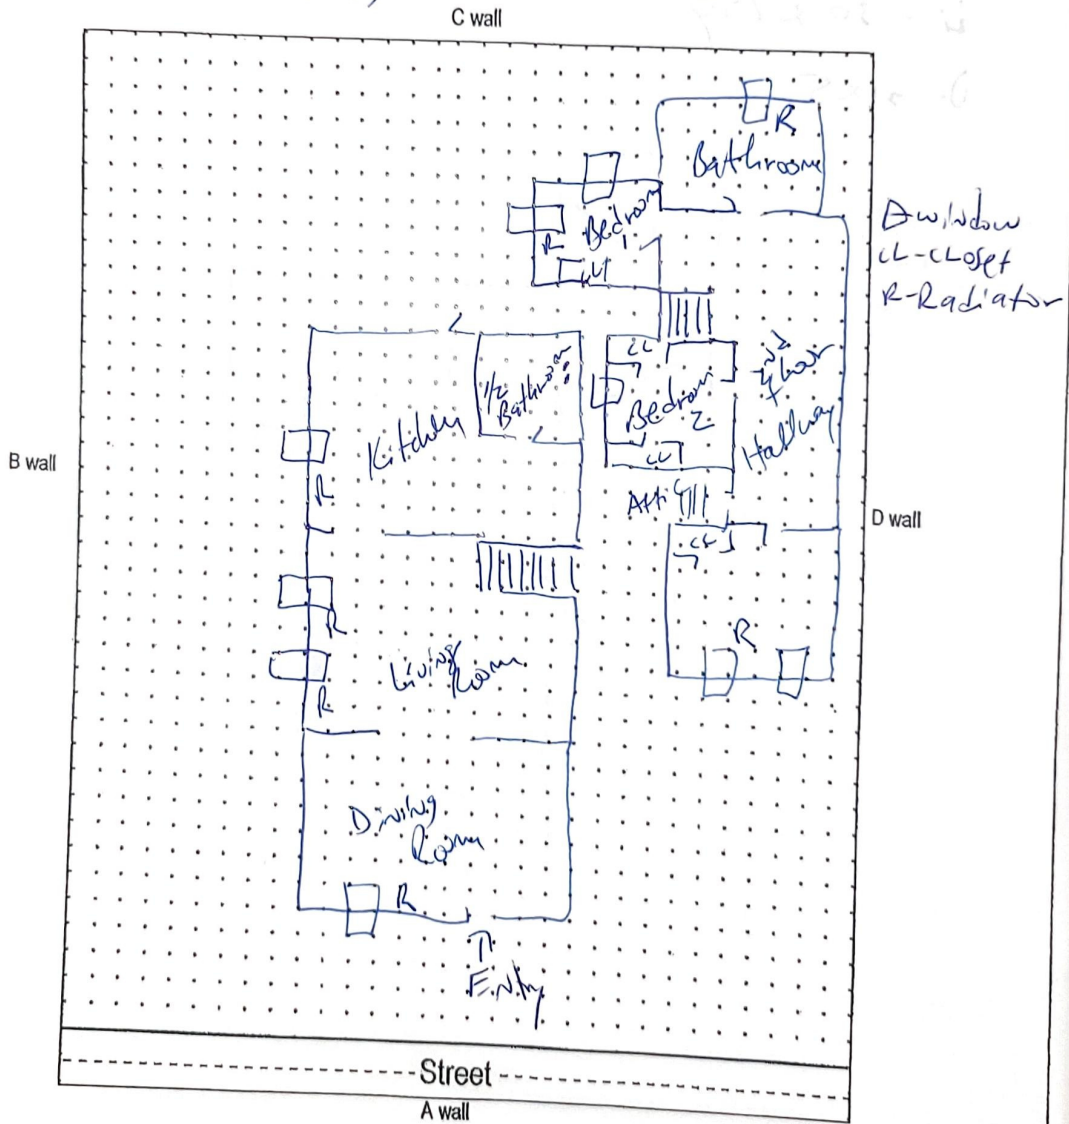

Floor 1

Lew Environmental Services - 207 Lewis Street Unit: Primary - Visual Inspection
Prepared By: LEW Environmental Services, LLC
07/02/2024

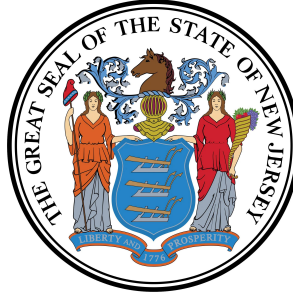

Lead Safe Certificate

It is hereby certified that a lead based paint visual inspection and/or dust wipe sampling has been performed in accordance with the protocols referenced in N.J.A.C. 5:17, and the results of which indicate that no lead-based paint hazards have been found in the dwelling unit listed below. It shall be the owner's responsibility to perform any required on-going evaluation and maintenance to ensure that the dwelling unit remain in a Lead - Safe condition. PURSUANT TO P.L.2003, c.311 (C.52:27D-437.1 et. seq.)

This certificate is **Valid For Two Years**

207 Lewis Street Unit:Primary Phillipsburg Town, NJ 08865

1316

7

Site Address

Block

Lot

Applicable Dwelling Unit: **207 Lewis Street Unit:Primary**

(CERTIFICATE IS VALID FOR A DWELLING UNIT AND SHALL BE AFFIXED TO LEASE)

Insp/RA Name: Yerani Heredia De Rosado

Evaluation Contractor #: 00015-E

Phone: 908-654-8068

Contractor Name:

Lew Environmental Services, LLC

Contractor Address:

181 US Hwy 46

Mine Hill, NJ 07830

Yerani Heredia

R001913

Signature

ID#

Date Issued:

06/24/2024

(mm/dd/yyyy)