



181 US Hwy 46
Mine Hill, NJ 07830
(908) 654-8068
(800) 783-0567
Fax 908-654-8069

Lead Dust Wipe Report

For 226 Chambers St Unit:1 Phillipsburg Town, NJ 08865
05/26/2024

On 05/03/2024, LEW Environmental Services, LLC (NJDC 00015 E) performed a dust wipe sampling for the presence of lead at 226 Chambers St Unit:1, (the "property") in compliance with NJAC 5:28A. We conducted our inspection in accordance with all federal, state, and municipal regulations. The regulations and inspection standards require that we plan and perform the inspection to obtain a reasonable assurance about whether or not the property is at risk from lead dust.

The maintenance and the environmental conditions of the property are the responsibility of the property's management, principals, or owners. If the property, program, or any of its tenants receive financial federal assistance, the results of this evaluation must be provided by the designated party (client) to the owner of the referenced property and the occupants within 15 calendar days of the date when the designated party receives this report or makes the presumption that lead-based paint hazards exist, per the Department of Housing and Urban Development 24 CFR Part 35.125.

All dust wipes tested are not considered actionable for lead dust. The property may still contain lead painted components and lead dust re-accumulation is possible.

Respectfully Submitted,

A handwritten signature in black ink, appearing to read 'Nyire Grant', is written in a cursive style.

Nyire Grant
NJDOH Risk Assessor, NJDOH ID#021517
Encl: Laboratory Results, Floor Plan, Lead-safe Certificate



Environmental Hazards Services, L.L.C.
 7469 Whitepine Rd
 Richmond, VA 23237
 Telephone: 800.347.4010

Lead Dust Wipe Analysis Report

Report Number: 24-05-00948

Client: LEW Corp
 181 US Hwy 46
 Mine Hill, NJ 07803

Received Date: 05/06/2024
 Analyzed Date: 05/08/2024
 Reported Date: 05/08/2024

Project/Test Address: 32112; 226 Chambers; Philipsburg, NJ
 Collection Date: 05/03/2024

Client Number:
 201327

Laboratory Results

Fax Number:
 Ext 18 Melissa

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft ²)	Concentration (ug/ft ²)	Narrative ID
24-05-00948-001	01	DEN	FL	<5.00	1.00	<5.00	
24-05-00948-002	02	DEN	SL	5.16	0.753	6.85	
24-05-00948-003	03	BED 1	FL	<5.00	1.00	<5.00	
24-05-00948-004	04	BED 1	SL	19.8	0.486	40.7	
24-05-00948-005	05	BED 2	FL	<5.00	1.00	<5.00	
24-05-00948-006	06	BED 2	SL	26.5	0.462	57.4	
24-05-00948-007	07	LIVING	FL	<5.00	1.00	<5.00	
24-05-00948-008	08	LIVING	SL	47.6	0.681	69.8	

Environmental Hazards Services, L.L.C

Client Number: 201327

Report Number: 24-05-00948

Project/Test Address: 32112; 226 Chambers; Philipsburg, NJ

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft ²)	Concentration (ug/ft ²)	Narrative ID
-------------------	----------------------	---------------------	---------	---------------	------------------------------	-------------------------------------	--------------

Method: ASTM E-1979-17/EPA SW846 7000B

Accreditation #:

Reviewed By Authorized Signatory: Melissa Kanode

Melissa Kanode

QA/QC Clerk

The Reporting Limit (RL) is 5.00 ug Total Pb. Dust wipe area and results are calculated based on area measurements determined by the client. All internal quality control requirements associated with this batch were met, unless otherwise noted.

The condition of the samples analyzed was acceptable upon receipt per laboratory protocol unless otherwise noted on this report. Results represent the analysis of samples submitted by the client. Sample location, description, area, etc., was provided by the client. Results reported above in ug/ft² are calculated based on area supplied by the client. If the report does not contain the result for a field blank, it is due to the fact that the client did not include a field blank with their samples. These sample results do not reflect blank correction. This report shall not be reproduced except in full, without the written consent of Environmental Hazards Services, L.L.C.

ELLAP Accreditation through AIHA LAP, LLC (100420), NY ELAP #11714.

Legend	ug = microgram	ug/ft ² = micrograms per square foot	Pb = lead
	mL = milliliter	ft ² = square foot	



ENVIRONMENTAL SERVICES

A Moline Company

LEW Environmental Services P: (800) 783-0567

F: (908) 654-8069

Lead

Chain-of-Custody

24-05-00948



Due Date:

05/09/2024

(Thursday)

* All

SI

AE

ents.


Project Name: <u>32112 - 226 Chambers</u>		Sample Type		Turn Around Time (TAT)		Sampler Information	
Address: <u>226 Chambers</u>		<input checked="" type="checkbox"/> Dust wipe <input type="checkbox"/> Paint chip <input type="checkbox"/> Soil <input type="checkbox"/> TCLP		<input type="checkbox"/> Same Day <input type="checkbox"/> 1 Day <input type="checkbox"/> 1 Week <input checked="" type="checkbox"/> 3 Day <input type="checkbox"/> Weekend <input type="checkbox"/> 2 Weeks		Name: <u>Nyire Grant</u>	
City, State: <u>Phillipsburg, NJ</u>						Signature: <u>Nyire Grant</u>	
Project Number: <u>32112</u>							

Sample #	Date Collected	Sample Location (Ex: Fl, Kitchen, AC)	Area (inches)	Paint Chip Analysis		
				mg/cm ²	PPM	% wt
01	5-3-24	Den Fl	12 x 12			
02	5-3-24	Den ws	3 1/2 x 31			
03	5-3-24	Bed1 Fl	12 x 12			
04	5-3-24	Bed1 ws	3 1/2 x 20			
05	5-3-24	Bed2 Fl	12 x 12			
06	5-3-24	Bed2 ws	3 1/2 x 19			
07	5-3-24	Living Fl	12 x 12			
08	5-3-24	Living ws	3 1/2 x 28			
				X		
				X		
				X		
				X		

85

Relinquished by: <u>Nyire Grant</u>	Signature: <u>Nyire Grant</u>	Date/Time: <u>5-3-24</u>
Received by: <u>Soaker</u>	Signature: <u>Soaker</u>	Date/Time: <u>5/6/24</u>

Floor Plan(s)

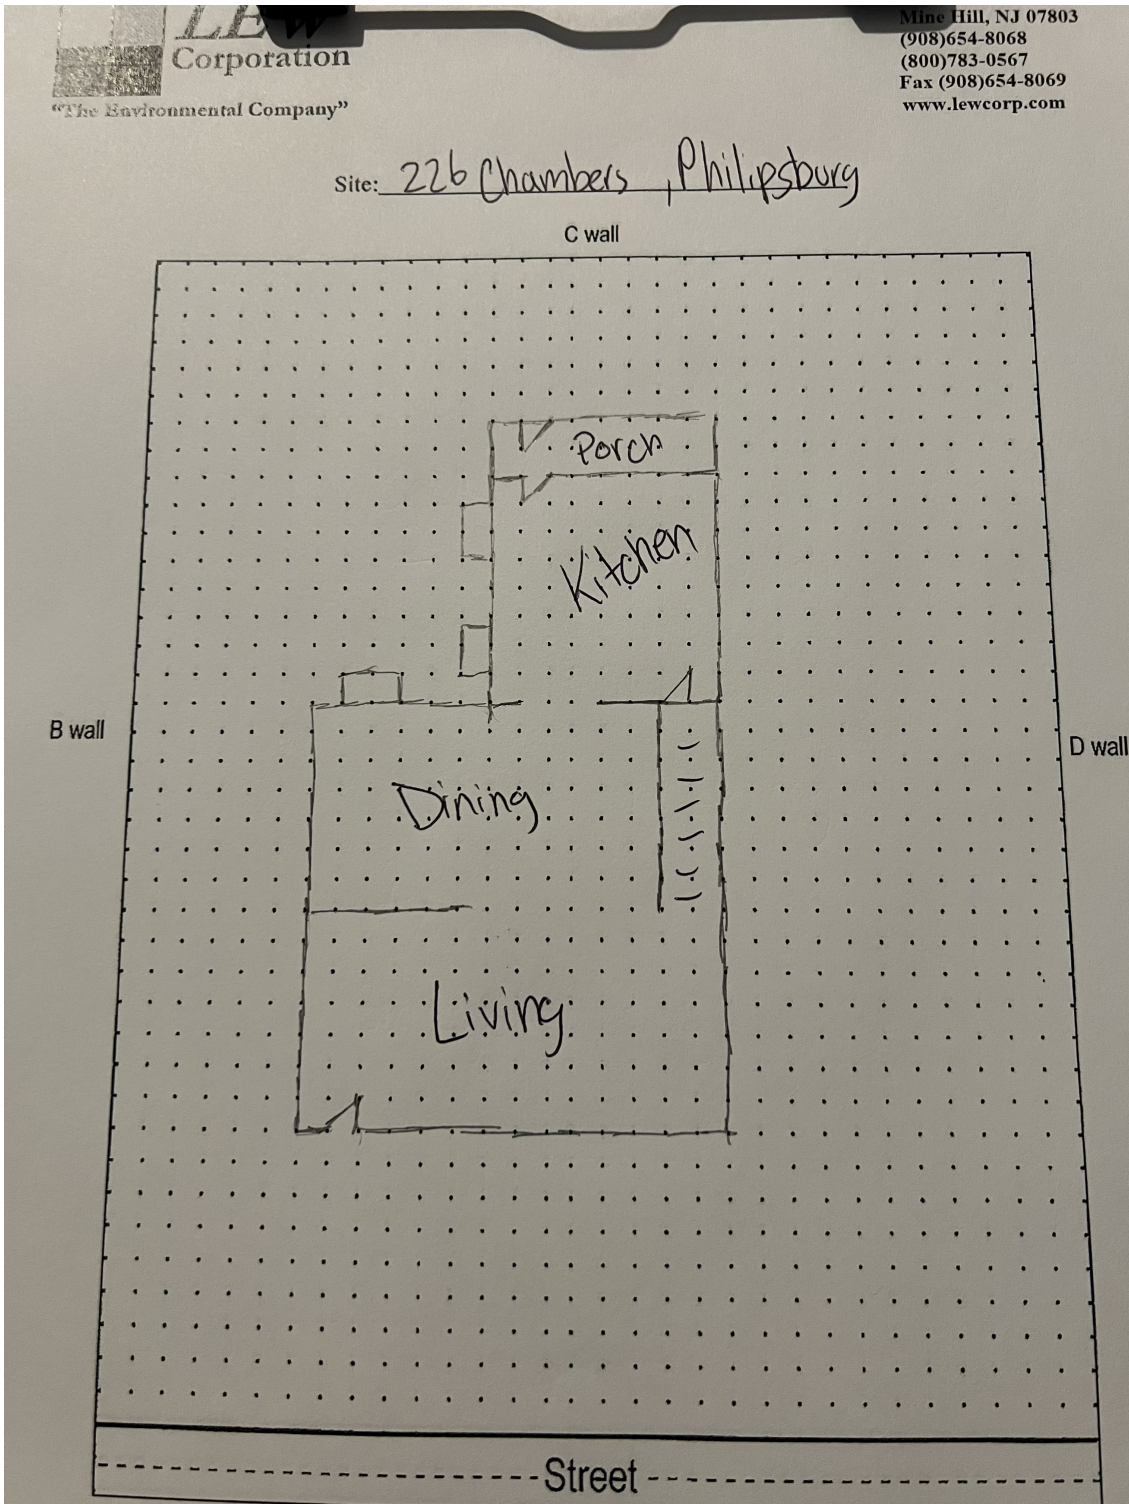

Floor 1

Lew Environmental Services - 226 Chambers St Unit:1 -Visual Inspection
Prepared By: LEW Environmental Services, LLC
05/26/2024




LEW
Corporation

"The Environmental Company"

Route 46
Mine Hill, NJ 07803
(908)654-8068
(800)783-0567
Fax (908)654-8069
www.lewcorp.com

Site: _____

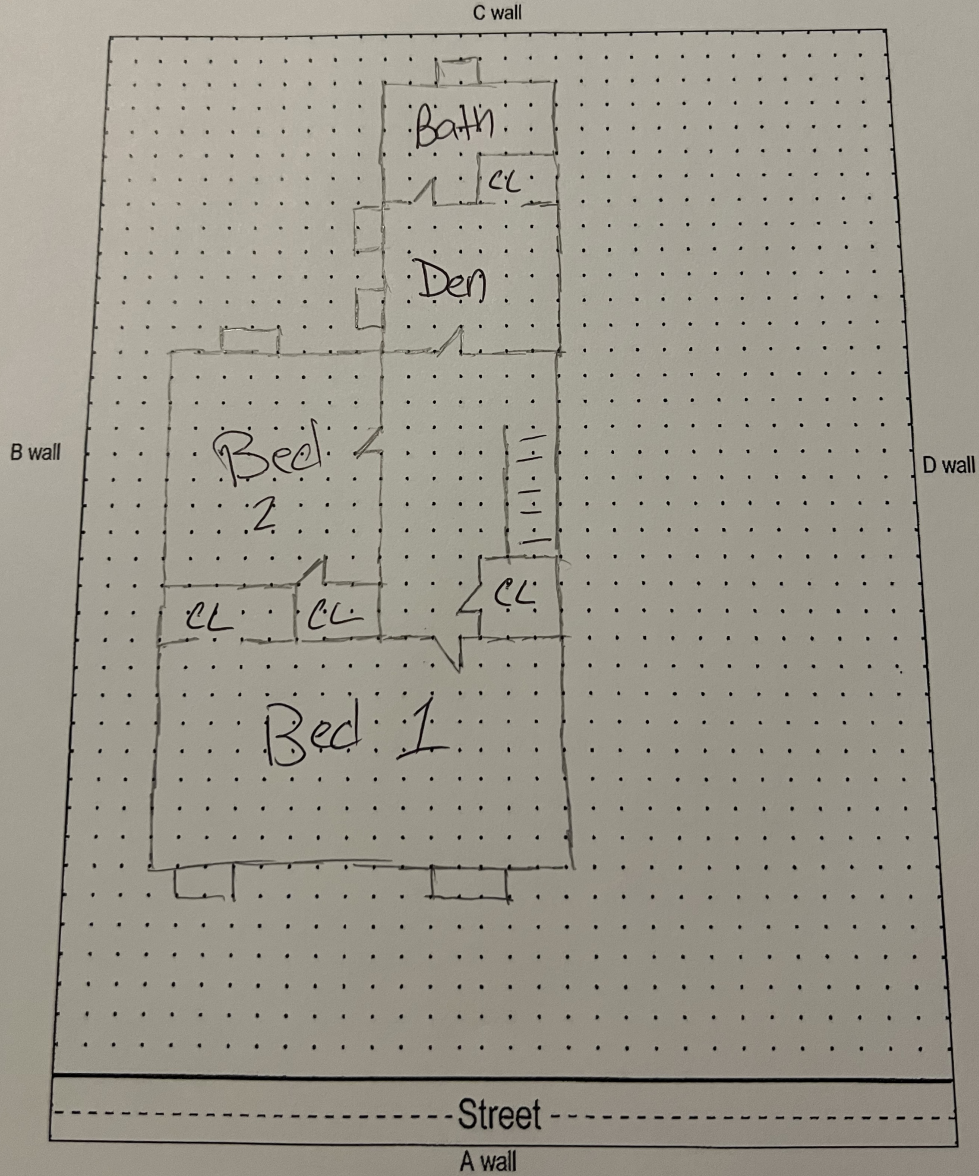


Floor 2

Lew Environmental Services - 226 Chambers St Unit:1 -Visual Inspection

Prepared By: LEW Environmental Services, LLC

05/26/2024

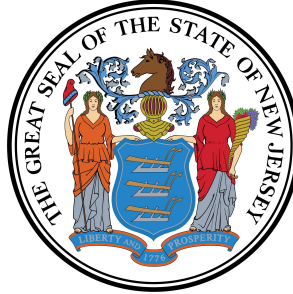

Lead Safe Certificate

It is hereby certified that a lead based paint visual inspection and/or dust wipe sampling has been performed in accordance with the protocols referenced in N.J.A.C. 5:17, and the results of which indicate that no lead-based paint hazards have been found in the dwelling unit listed below. It shall be the owner's responsibility to perform any required on-going evaluation and maintenance to ensure that the dwelling unit remain in a Lead - Safe condition. PURSUANT TO P.L.2003, c.311 (C.52:27D-437.1 et. seq.)

This certificate is **Valid For Two Years**

226 Chambers St Unit:1 Phillipsburg Town, NJ 08865

1409

9

Site Address

Block

Lot

Applicable Dwelling Unit: **226 Chambers St Unit:1**

(CERTIFICATE IS VALID FOR A DWELLING UNIT AND SHALL BE AFFIXED TO LEASE)

Insp/RA Name: Nyire Grant

Evaluation Contractor #: 00015-E

Phone: 908-654-8068

Signature

021517

ID#

Contractor Name:

Low Environmental Services, LLC

Contractor Address:

181 US Hwy 46

Mine Hill, NJ 07830

Date Issued:

05/03/2024

(mm/dd/yyyy)