

181 US Hwy 46 Mine Hill, NJ 07803 (908) 654-8068 (800) 783-0567 Fax 908-654-8069

Visual Paint Assessment Report

For: 89 Grant St, Boonton, Apt. 2, NJ 07005 March 1, 2024

On March 1, 2024, LEW Environmental Services, LLC (NJDCA 00015 E) performed a visual paint condition assessment for the presence of deteriorated paint, chips or dust from painting activities and paint residue on floors at 89 Grant St, Boonton, Apt. 2, NJ 07005, (the "property") in compliance with NJAC 5:28A. Only the dwelling and common area interiors were included. Exteriors were not part of the assessment. The visual assessment followed the protocols found in HUD's Visual Assessment Training course.

Deteriorated paint, chips or dust from painting activities and paint residue on floors were observed on the following components/surfaces.

Room	Component	Hazard	Treatment
Living Room	Door, Door Jamb &	Deteriorated	Scrape loose paint
	Casing Wall D	Paint	and apply new
	_		coat
Living Room	Window Casings	Deteriorated paint	Repaint
Bedroom 1	Door Casing, Jamb	Deteriorated	Scrape loose paint
	and Stop (Wall C);	Paint	and apply new
	Closet Door Jamb		coat
	(Wall D)		
Bathroom	Door	Deteriorated	Repaint/Paint
		Paint	Stabilization
Bedroom 2	Door, Jamb &	Deteriorated	Repaint
	Casing (Wall A)	Paint	
Kitchen	Closet Door, Jamb	Deteriorated	Scrape loose paint
	and Casing in Wall	Paint	and apply new
	Α		coat
Kitchen	Door Casing (Wall	Deteriorated	Repaint
	D)	Paint	
Attic Bedroom 1	Door	Deteriorated	Repaint
		Paint	-

Identified hazards shall be remediated using either abatement (permanent) or interim controls (temporary). Abatement shall be performed by a NJ Licensed lead abatement firm using licensed lead abatement supervisors and workers. Interim control work shall be performed by EPA RRP certified firms using an EPA certified RRP Renovator. After completion of interim control work, a lead-based paint post-remediation with dust wipes will be required. After completion of abatement work, a lead-based paint abatement clearance will be required.

Respectfully submitted,

Gerani Heredia

Yerani Heredia Risk Assessor, NJDOH ID# R001913

Encl: Photographs, Floor Plan



Photographs



Kitchen Door Casing





Bedroom 1 Closet Door Jamb





Bedroom 1 Door Jamb in Wall C





Living Room Window Casing

Bedroom 1 Door Jamb





Living Room Door and Door Jamb in Wall D





Bedroom 1 Door in Wall C






Kitchen Closet Door


Kitchen Closet Door Jamb



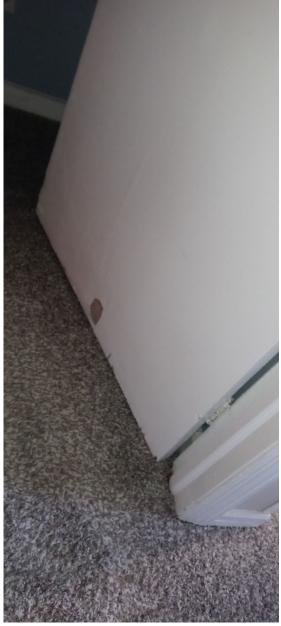


Attic Bedroom 1 Door



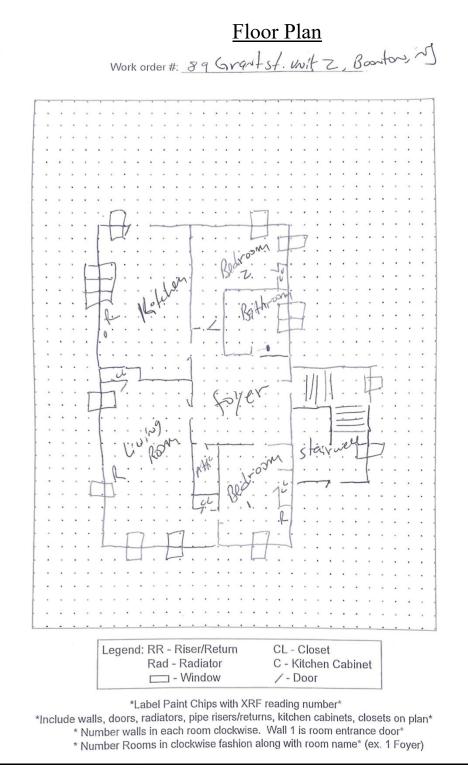



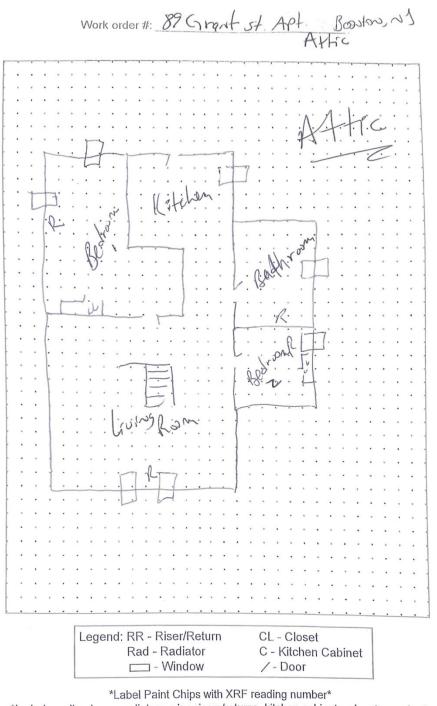

Include walls, doors, radiators, pipe risers/returns, kitchen cabinets, closets on plan

* Number walls in each room clockwise. Wall 1 is room entrance door*

* Number Rooms in clockwise fashion along with room name* (ex. 1 Foyer)



PHILIP D. MURPHY

Governor LOCATION 101 S BROAD ST TRENTON NJ 08608 STATE OF NEW JERSEY DEPARTMENT OF COMMUNITY AFFAIRS DIVISION OF CODES AND STANDARDS LEAD HAZARD UNIT LT. GOVERNOR SHEILA Y. OLIVER

Commissioner

MAILING ADDRESS 101 S BROAD ST TRENTON NJ 08618

Certificate - Lead Evaluation Contractor

RECERTIFIED

This is to certify that the Department of Community Affairs has certified

LEW ENVIRONMENTAL SERVICES,LLC 181 US HIGHWAY 46 MINE HILL NJ 07803

To act as a Lead Evaluation Contractor on the following Projects

Residential Public Buildings Comm/Steel Structure

Cert #:00015-EEffective Date:4/1/2023Expiration Date:3/31/2025Certificate Type:2 YEAR





PHILIP D. MURPHY

Governor LOCATION 101 S BROAD ST TRENTON NJ 08608 STATE OF NEW JERSEY DEPARTMENT OF COMMUNITY AFFAIRS DIVISION OF CODES AND STANDARDS LEAD HAZARD UNIT LT. GOVERNOR SHEILA Y, OLIVER

Commissioner

MAILING ADDRESS 101 S BROAD ST TRENTON NJ 08618

3/23/2023

00015-E

LEW ENVIRONMENTAL SERVICES,LLC 181 US HIGHWAY 46 MINE HILL NJ 07803

Dear LEE E. WASSERMAN

Enclosed is the certification necessary for your firm to work as a Lead Evaluation Contractor in New Jersey. If you have any questions or need additional information, please call at (609) 633-6224.

Sincerely,

O. Tex Falajiki Supervisor of Certification Lead Hazard Unit



