



181 US Hwy 46  
Mine Hill, NJ 07830  
(908) 654-8068  
(800) 783-0567  
Fax 908-654-8069

## Lead Dust Wipe Report

For 649-51 e 6th St Unit:1 Plainfield City, NJ 07060  
09/27/2024

On 09/12/2024, LEW Environmental Services, LLC (NJDC 00015 E) performed a dust wipe sampling for the presence of lead at 649-51 e 6th St Unit:1, (the "property") in compliance with NJAC 5:28A. We conducted our inspection in accordance with all federal, state, and municipal regulations. The regulations and inspection standards require that we plan and perform the inspection to obtain a reasonable assurance about whether or not the property is at risk from lead dust.

The maintenance and the environmental conditions of the property are the responsibility of the property's management, principals, or owners. If the property, program, or any of its tenants receive financial federal assistance, the results of this evaluation must be provided by the designated party (client) to the owner of the referenced property and the occupants within 15 calendar days of the date when the designated party receives this report or makes the presumption that lead-based paint hazards exist, per the Department of Housing and Urban Development 24 CFR Part 35.125.

**All dust wipes tested are not considered actionable for lead dust.** The property may still contain lead painted components and lead dust re-accumulation is possible.

Respectfully Submitted,

A handwritten signature in cursive script that reads 'Yerani Heredia'.

Yerani Heredia De Rosado  
NJDOH Risk Assessor, NJDOH ID#R001913  
Encl: Laboratory Results, Floor Plan, Lead-safe Certificate



7469 Whitepine Rd  
 North Chesterfield, VA 23237  
 Telephone: 800.347.4010

# Lead Dust Wipe Analysis Report

**Report Number:** 24-09-02612

**Client:** LEW Corp  
 181 US Hwy 46  
 Mine Hill, NJ 07803

**Received Date:** 09/16/2024  
**Analyzed Date:** 09/18/2024  
**Reported Date:** 09/19/2024

**Project/Test Address:** 77153; Dust Wipe Sampling; 649-51 East 6th St Unit 1; Plainfield, NJ  
**Collection Date:** 09/12/2024

**Client Number:**  
 201327

## Laboratory Results

**Fax Number:**  
 Ext 18 Melissa

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft <sup>2</sup> )	Concentration (ug/ft <sup>2</sup> )	Narrative ID
24-09-02612-001	1	SUNROOM AC	FL	<5.00	1.00	<5.00	
24-09-02612-002	2	REAR ENTRY AC	FL	<5.00	1.00	<5.00	
24-09-02612-003	3	2ND FLOOR HALLWAY AC	FL	<5.00	1.00	<5.00	
24-09-02612-004	4	BEDROOM 2 AC	FL	<5.00	1.00	<5.00	
24-09-02612-005	5	BEDROOM 4 AC	FL	<5.00	1.00	<5.00	
24-09-02612-006	6	2ND FLOOR HALLWAY BC	SL	<5.00	0.521	<9.60	
24-09-02612-007	7	BEDROOM 2 DC	SL	32.4	0.417	77.7	
24-09-02612-008	8	BEDROOM 4 DC	SL	<5.00	0.417	<12.0	
24-09-02612-009	9	BEDROOM 1 DC	SL	<5.00	0.521	<9.60	
24-09-02612-010	10	BEDROOM 1 DC	FL	<5.00	1.00	<5.00	

# Environmental Hazards Services, L.L.C

Client Number: 201327

Report Number: 24-09-02612

Project/Test Address: 77153; Dust Wipe Sampling; 649-51 East 6th St Unit  
1; Plainfield, NJ

---

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft <sup>2</sup> )	Concentration (ug/ft <sup>2</sup> )	Narrative ID
-------------------	----------------------	---------------------	---------	---------------	------------------------------	-------------------------------------	--------------

---

Method: ASTM E-1979-17/EPA SW846 7000B

Accreditation #:

Reviewed By Authorized Signatory: Melissa Kanode

Melissa Kanode

QA/QC Clerk

The Reporting Limit (RL) is 5.00 ug Total Pb. Dust wipe area and results are calculated based on area measurements determined by the client. All internal quality control requirements associated with this batch were met, unless otherwise noted.

The condition of the samples analyzed was acceptable upon receipt per laboratory protocol unless otherwise noted on this report. Results represent the analysis of samples submitted by the client. Sample location, description, area, etc., was provided by the client. Results reported above in ug/ft<sup>2</sup> are calculated based on area supplied by the client. If the report does not contain the result for a field blank, it is due to the fact that the client did not include a field blank with their samples. These sample results do not reflect blank correction. This report shall not be reproduced except in full, without the written consent of Environmental Hazards Services, L.L.C.

ELLAP Accreditation through AIHA LAP, LLC (100420), NY ELAP #11714.

---

Legend	ug = microgram	ug/ft <sup>2</sup> = micrograms per square foot	Pb = lead
	mL = milliliter	ft <sup>2</sup> = square foot	

---



# ENVIRONMENTAL SERVICES

A Mainline Company

LEW Environmental Services P: (800) 783-0567

F: (908) 654-8069

## Lead

### Chain-of-Custody

24-09-02612



Due Date:

09/19/2024

(Thursday)

AE

\* All wipe samples...

nts.

Project Name: Dust wipe Samplings  
 Address: 649-51 East 6<sup>th</sup> St. Unit 1  
 City, State: Plainfield, NJ  
 Project Number: Order # 77153

Sample Type  
 Dust wipe  
 Paint chip  
 Soil  
 TCLP

Turn Around Time (TAT)  
 Same Day  
 1 Day  
 1 Week  
 3 Day  
 Weekend  
 2 Weeks

Sampler Information  
 Name: \_\_\_\_\_  
 Signature: \_\_\_\_\_

Sample #	Date Collected	Sample Location (Ex: Fl, Kitchen, AC)	Area (inches)	Paint Chip Analysis		
				mg/cm <sup>2</sup>	PPM	% wt
1	09-12-24	Floor Sun Room AC	12 x 12			
2		Floor Rear Entry AC	12 x 12			
3		Floor 2 <sup>nd</sup> floor Hallway AC	12 x 12			
4		Floor Bedroom 2 AC	12 x 12			
5		Floor Bedroom 4 AC	12 x 12			
6		w-sill 2 <sup>nd</sup> floor Hallway BL	30 x 2 1/2			
7		w-sill Bedroom 2 DC	30 x 2			
8		w-sill Bedroom 4 DC	30 x 2			
9		w-sill Bedroom 1 DC	30 x 2 1/2			
10		Floor Bedroom 1 DC	12 x 12			


Relinquished by: Yvonne Heredia Signature: Yvonne Heredia Date/Time: 09-12-24 8:29 am  
 Received by: DBAUN Signature: DBAUN Date/Time: 09/10/24 3:37 pm

# Floor Plan(s)



181 US Hwy 46  
Mine Hill, NJ 07803  
(908) 654-8068  
(800) 783-0567  
Fax (908) 654-8069  
www.lewenvironmental.com


Site: 649-51 East 6<sup>th</sup> St. Plainfield, NJ  
2<sup>nd</sup> floor unit

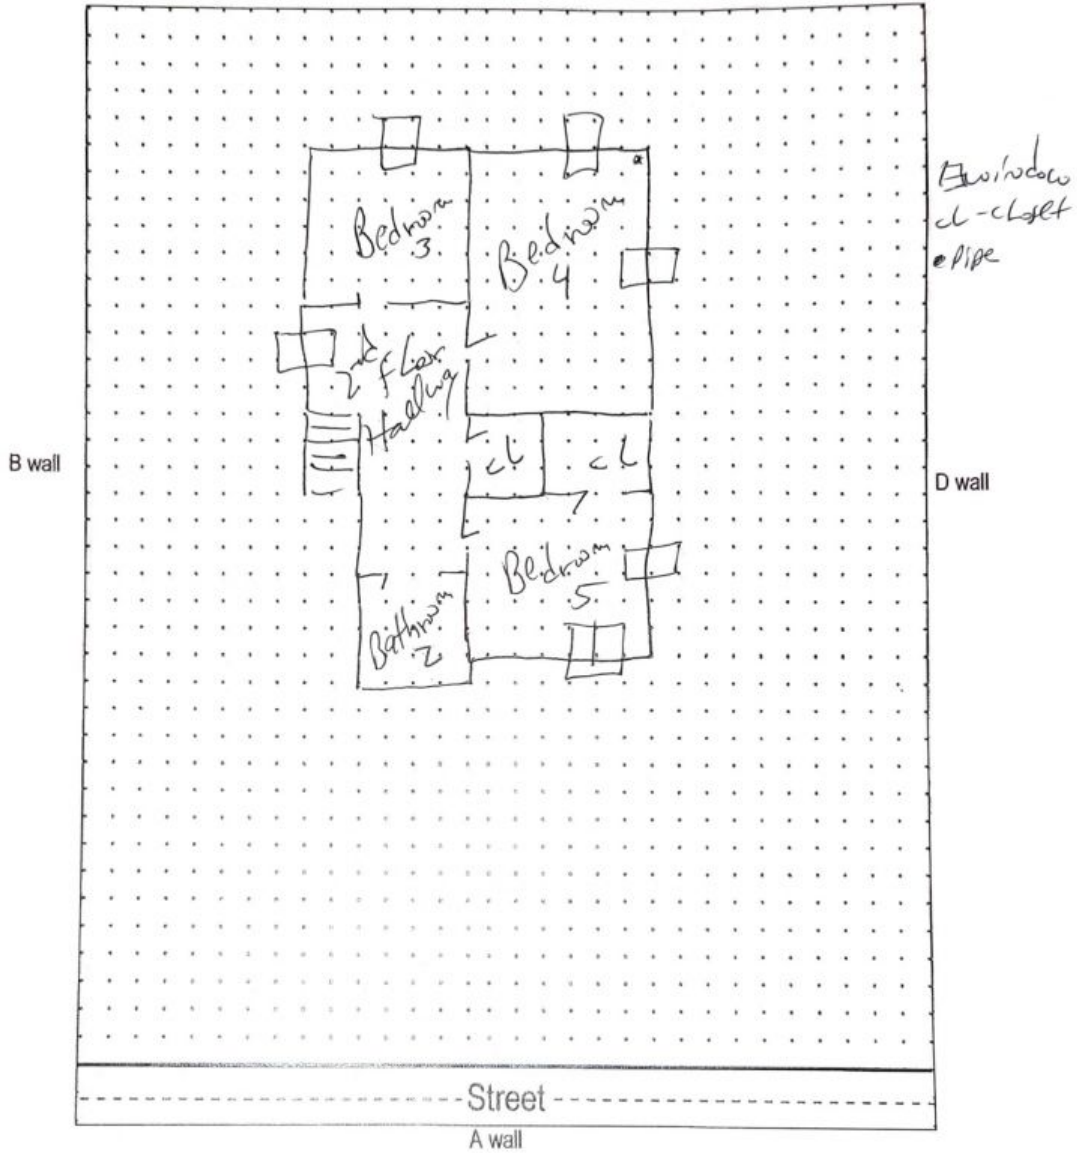

Floor 1


Lew Environmental Services - 649-51 e 6th St Unit:1 -Visual Inspection  
Prepared By: LEW Environmental Services, LLC  
09/27/2024

Site: 649-51 East 6<sup>th</sup> St. unit 1, Plainfield NJ  
 1st & 2nd

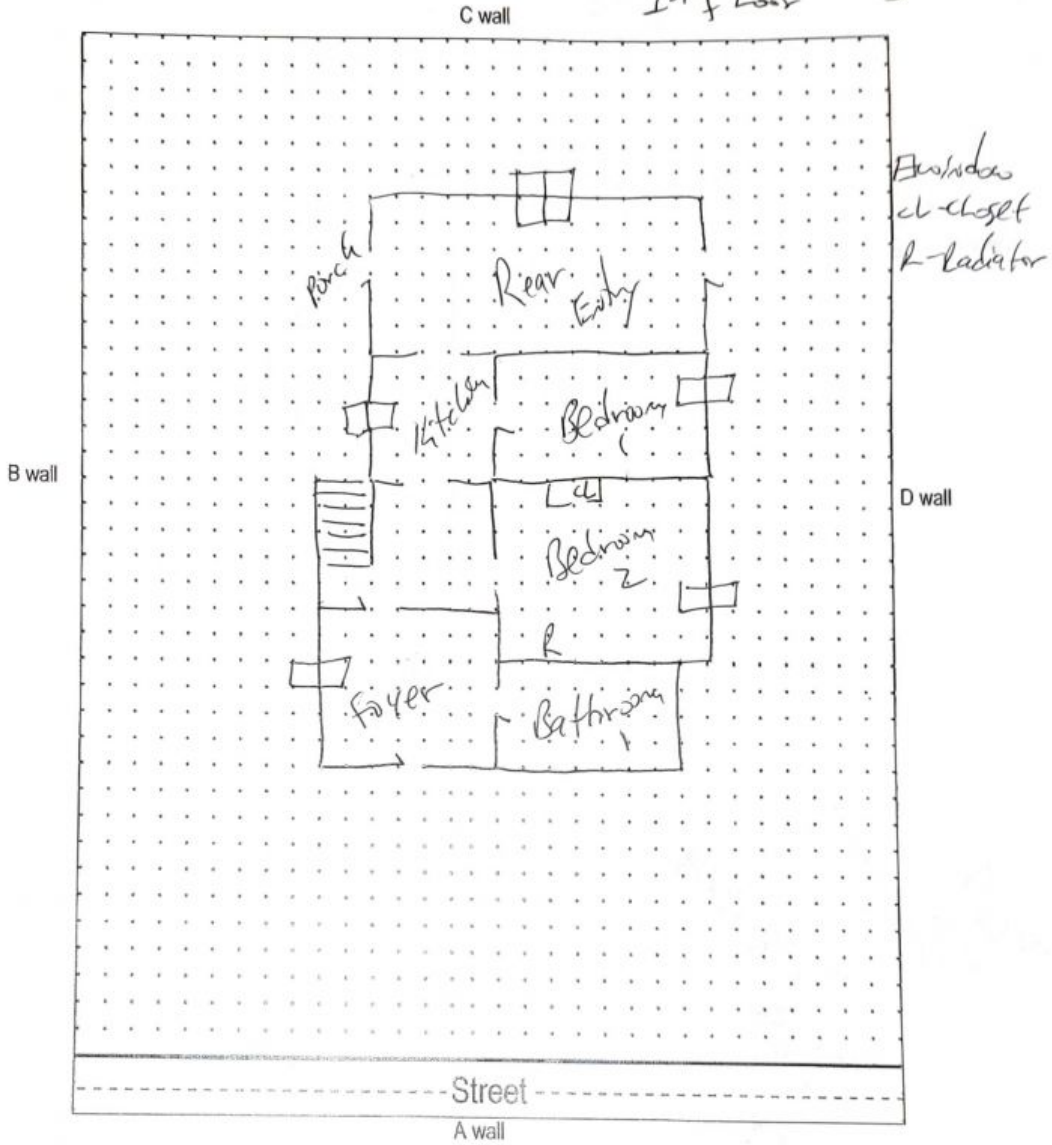

Floor 2

Lew Environmental Services - 649-51 e 6th St Unit:1 -Visual Inspection  
 Prepared By: LEW Environmental Services, LLC  
 09/27/2024

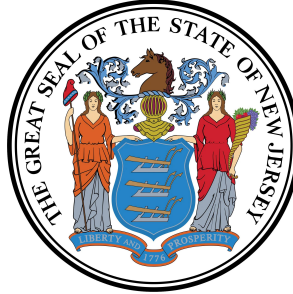

# Lead Safe Certificate

It is hereby certified that a lead based paint visual inspection and/or dust wipe sampling has been performed in accordance with the protocols referenced in N.J.A.C. 5:17, and the results of which indicate that no lead-based paint hazards have been found in the dwelling unit listed below. It shall be the owner's responsibility to perform any required on-going evaluation and maintenance to ensure that the dwelling unit remain in a Lead - Safe condition. PURSUANT TO P.L.2003, c.311 (C.52:27D-437.1 et. seq.)

This certificate is **Valid For Two Years**

649-51 e 6th St Unit:1 Plainfield City, NJ 07060

614

14

Site Address

Block

Lot

Applicable Dwelling Unit: **649-51 e 6th St Unit:1**

(CERTIFICATE IS VALID FOR A DWELLING UNIT AND SHALL BE AFFIXED TO LEASE)

Insp/RA Name: Yerani Heredia De Rosado

Evaluation Contractor #: 00015-E

Phone: 908-654-8068

**Contractor Name:**

Lew Environmental Services, LLC

**Contractor Address:**

181 US Hwy 46

Mine Hill, NJ 07830

*Yerani Heredia*

R001913

Signature

ID#

**Date Issued:**

09/12/2024

(mm/dd/yyyy )