



## **Lead Dust Wipe Report**

For 49 Atlantic St Unit:1 Elizabeth City, NJ 07206 11/26/2024

On 11/13/2024, LEW Environmental Services, LLC (NJDCA 00015 E) performed a dust wipe sampling for the presence of lead at 49 Atlantic St Unit:1, (the "property") in compliance with NJAC 5:28A. We conducted our inspection in accordance with all federal, state, and municipal regulations. The regulations and inspection standards require that we plan and perform the inspection to obtain a reasonable assurance about whether or not the property is at risk from lead dust.

The maintenance and the environmental conditions of the property are the responsibility of the property's management, principals, or owners. If the property, program, or any of its tenants receive financial federal assistance, the results of this evaluation must be provided by the designated party (client) to the owner of the referenced property and the occupants within 15 calendar days of the date when the designated party receives this report or makes the presumption that lead-based paint hazards exist, per the Department of Housing and Urban Development 24 CFR Part 35.125.

The following surfaces are considered actionable for the lead dust.

Room	Component
Bedroom 1	Window Sills

Identified dust hazards shall be remediated by lead dust cleaning. Cleaning shall be performed by EPA RRP certified firms using an EPA certified RRP Renovator. You can find certified EPA RRP contractors at https://cdxapps.epa.gov/ocspp-oppt-lead/firm-location-search. Select RRP Contractor, then NJ, then enter your zip code to search for contractors. After completion of interim control work, a lead-based paint post-remediation with dust wipes will be required.

### **Lead Dust Hazard Standards**

Floors (Bare and Carpeted)......< 10 ug/ft2 Window Sill...... < 100 ug/ft2

Respectfully Submitted,

Tale 1/ne

Pablo Viera

Risk Assesor, ID#D-I-T226395-24-00064 Encl: Laboratory Results, Floor Plan;



7469 Whitepine Rd North Chesterfield, VA 23237 Telephone: 800.347.4010

## Lead Dust Wipe Analysis Report

**Report Number:** 24-11-03252

**Received Date:** 11/18/2024

**Analyzed Date:** 11/20/2024 **Reported Date:** 11/21/2024

Client: LEW Corp

181 US Hwy 46 Mine Hill, NJ 07803

Project/Test Address: 122882; Victor Landaverde; 49 Atlantic St Unit 1; Elizabeth, NJ

Collection Date: 11/13/2024

Client Number: 201327 Laboratory Results Fax Number: Ext 18 Melissa

Lab Sample Number	Client Sample Number	Collection Location	Surface	Total Pb (ug)	Wipe Area (ft²)	Concentration (ug/ft²)	Narrative ID
24-11-03252- 001	49-1	SUN ROOM	FL	<5.00	1.00	<5.00	
24-11-03252- 002	49-2	KITCHEN BC	FL	<5.00	1.00	<5.00	
24-11-03252- 003	49-3	LIVING ROOM AC	FL	<5.00	1.00	<5.00	
24-11-03252- 004	49-4	BATHROOM CC	FL	<5.00	1.00	<5.00	
24-11-03252- 005	49-5	BEDROOM 1 DC	FL	6.28	1.00	6.28	
24-11-03252- 006	49-6	KITCHEN	SL	6.76	0.370	18.3	
24-11-03252- 007	49-7	LIVING ROOM A1	SL	<5.00	0.224	<22.4	
24-11-03252- 008	49-8	BATHROOM	SL	<5.00	0.794	<6.30	
24-11-03252- 009	49-9	BEDROOM 1	SL	6.20	0.0599	104	

## Environmental Hazards Services, L.L.C

**Client Number:** 201327 **Report Number:** 24-11-03252

Project/Test Address: 122882; Victor Landaverde; 49 Atlantic St Unit 1;

Elizabeth, NJ

Lab Sample Client Sample Collection Location Surface Total Pb Wipe Area Concentration Narrative Number (ug) (ft²) (ug/ft²) ID

Method: ASTM E-1979-17/EPA SW846 7000B

Accreditation #:

Reviewed By Authorized Signatory:

Melissa Kanode

Melissa Kanode

QA/QC Clerk

The Reporting Limit (RL) is 5.00 ug Total Pb. Dust wipe area and results are calculated based on area measurements determined by the client. All internal quality control requirements associated with this batch were met, unless otherwise noted.

The condition of the samples analyzed was acceptable upon receipt per laboratory protocol unless otherwise noted on this report. Results represent the analysis of samples submitted by the client. Sample location, description, area, etc., was provided by the client. Results reported above in ug/ft2 are calculated based on area supplied by the client. If the report does not contain the result for a field blank, it is due to the fact that the client did not include a field blank with their samples. These sample results do not reflect blank correction. This report shall not be reproduced except in full, without the written consent of Environmental Hazards Services, L.L.C.

ELLAP Accrediitation through AIHA LAP, LLC (100420), NY ELAP #11714.

Legendug = microgramug/ft² = micrograms per square footPb = leadmL = milliliterft² = square foot



# **ENVIRONMENTAL SERVICES**

A Mainline Company

LEW Environmental Services P: (800) 783-0567 F: (908) 654-8069

## Lead

## Chain-of-Custody

				· · · · · · · · · · · · · · · · · · ·	penne
AF	(Thursday)	11/21/2024	Due Date:		24-11-03252

				* All wipes			ç,
Project Name: Victor Land	Victor Landaverde	Sample Type	ound Tim	Sampler	Sampler Information	2	
<u></u>	NJ 111+1	Paint chip	1 Day Weekend	Name: /allo Uico	8 3		
1 1							
Sample #	Date Collected	(0)	Sample Location	Area	Paint C	Paint Chip Analysis	/sis
	מות כסוות כנותם	(E	(Ex: Fl, Kitchen, AC)	(inches)	mg/cm²	PPM	% wt
100	11-13-24	SUN ROON	80~	12 × 12			
2		Kitele Floor	Floor BC	×			
-		Liwing 1200m	1200m AC	×			
-<		Berthman 17001	Hoof CC	×			
-5		Belram	Balroom 1 Floor OC	×			
76		Kirden Sill		351/2 × 11/2			
+		Living Room Sill	7	211/2 × 11/2			
20		Bathlown Sill		3042 × 334			
3		Dedicion 1 Sil		3472 × 1/4			
				×	new desployayayaya dan me 6 ( hi k		
				×			
				×			
							-

Relinquished by:
Received by:


Signature: Signature:

Date/Time:
Date/Time:

## Floor Plan(s)



181 US Hwy 46 Mine Hill, NJ 07803 (908) 654-8068 (800) 783-0567 Fax (908) 654-8069

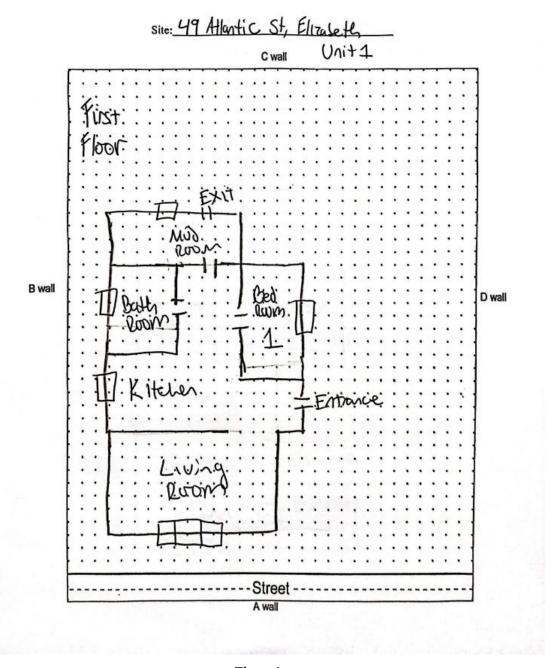

Floor 1

Lew Environmental Services - 49 Atlantic St Unit:1 -Visual Inspection Prepared By: LEW Environmental Services, LLC 11/26/2024